



# **OVR**

## **Optical Time Domain Reflectometer**

### **User's Guide**

**This guide is written for use with the OVR series.  
This includes the standard OVR OTDRs, OVR-PON and OVR-CWDM**

**Revision D  
04/2016**

Information contained in this manual is believed to be accurate and reliable, however, no responsibility is assumed by Fiber Instrument Sales Inc. for its use nor for any infringements of patents or other rights of third parties that may result from its use. No license is granted by implication or otherwise under any patent rights of Fiber Instrument Sales Inc.

The information contained in the publications is subject to change without notice.

1.	Using This Manual.....	1
2.	Safety.....	2
3.	OVR Quick Start Guide.....	4
4.	Introduction .....	6
5.	OTDR Inspection and Identification.....	7
	5.1    Inspection	
	5.2    Identification and Configuration	
6.	OVR Depscription.....	8
	6.1    OTDR Physical Description	
	Instrument Enclosure	
	Front View	
	Top View	
	6.2    Home Screen Display	
	6.3    Power Requirements	
	6.4    Battery Replacement	
	4 NiMH Batteries	
	Li-ion Pack	
7.	Fault Locator.....	11
	7.1    Fault Locator Screen	
	Event Table	
	Fib-R-Map	
	Event Table Field Definitions	
	7.2    Fault Locator Operation	
	Set Wavelength	
	Start Scan	
	Exit Fault Locator Mode	
8.	OTDR Operations.....	15
	8.1    Key Pad	
	8.2    Entering OTDR Function	
	8.3    Icon Definitions	
	8.4    Main OTDR screen	
	8.5    OTDR Parameter Settings Screen	
	Trace Parameters	
	Event Table/Fib-R-Map Sensitivity Settings	
	Pass/Fail Thresholds Settings	
	Date/Time Settings	
	Exit Parameter Settings Screen	

8.6	Auto Test	
	Set IOR	
	Set Wavelength	
	Start Auto Test	
8.7	Manual Expert Mode	
	Set IOR	
	Set Wavelength	
	Set Range	
	Set Pulse Width	
	Set Averaging Time	
	Scan	
8.8	Construction Mode	
	Create or Open a Project	
	Set Base File Name	
	Set Wavelengths	
	Start Testing	
	Exit Construction Mode	
8.9	Trace Analysis	
	Unit of Measure	
	Zoom	
	Cursor Movement	
8.10	Loss Measurements	
	2 Point Loss	
	dB/km	
	Optical Return Loss	
	Basic Splice Loss	
	Least Square Approximation (LSA)	
8.11	Loss Measurement Settings	
	Setting Splice Loss Measurement Areas	
	Splice Loss Measurement Areas	
	Splice Loss Adjustment Positions	
	LSA Examples	
8.12	Event Analysis	
	Enter Event Analysis	
	Threshold Settings	
	Sensitivity Settings	
	Macrobend Analysis	
	Event Analysis Screen	
	Fib-R-Map	
	Event Table	
	Event Table Field Descriptions	

9.	Project Management.....	33
9.1	Project Management Description	
	Project Management Screen	
	Project Management Menu	
	Project Management File Tab	
	Project Management Edit Tab	
	Project Management View/Help Tabs	
9.2	Project Management Operation	
	Create a New Project	
	Open an Existing Project	
	Delete a Project	
	Upload a Project to CertSoft	
	Rename a Project	
	Modify Properties	
	Temporary Modification of Parameters	
	Exit Project Management	
10.	File Management.....	37
10.1	File Management Description	
	File Management Screen	
	File Management Menu	
	File Management File Tab	
	File Management Edit Tab	
	File Management View/Help Tabs	
10.2	File Management Operation	
	Saving a Trace	
	Open/View a Trace	
	Dual Trace Mode	
	Delete a File	
	Upload a Trace to CertSoft	
	Rename a Trace File	
	Exit File Management	
11.	Video Scope.....	40
11.1	Entering Video Scope Function	
11.2	Video Scope Display	
11.3	Video Scope File/Help Icon Menu	
	Home	
	Quick Save	
	Project Management	
	File Management	
	Help	
11.4	Video Scope Operations Icon Menu	
	Grading Rings	
	Pass/Fail Label	
	Brightness	

11.5	Video Scope Operation	
	Video Probe Tips	
	Viewing/Focusing a Connector	
	Centering a Connector Image	
	Pausing Image Scan	
	Grading Rings	
	Pass/Fail	
	Auto Pass/Fail	
	Marking Points of Contamination	
	Exiting Video Scope Operation	
11.6	Pass/Fail Criteria Tables	
	Fiber End Face Criteria Table for Angled PC Polished Connectors	
	Fiber End Face Criteria Table for Ultra PC Polished Connectors	
	Fiber End Face Criteria Table for PC Polished Connectors	
12.	Loss Test Set.....	45
12.1	Entering Loss Test Set Function	
12.2	LTS File/Help Icon Menu	
	Home	
	Quick Save	
	Project Management	
	File Management	
	Help	
12.3	Light Source Operation	
	Selecting Light Source Wavelength	
	Selecting Source Modulation	
12.4	Power Meter Operation	
	Set Power Meter Wavelength	
	Set Reference	
	Set Measurement Units	
12.5	LTS Project Management	
12.6	LTS File Management	
12.7	Exit Loss Test Set	
12.	Specifications.....	47
13.1	OTDR Specifications	
13.2	Power Meter Specifications	
13.3	Light Source Specifications	
13.	Repair/Warranty.....	48
14.1	Repair Information	
14.2	Warranty Information	
15.	Version Control.....	49

# Chapter 1      Using This Manual

This manual contains operation information for the Fiber Instrument Sales Inc., OVR Optical Time Domain Reflectometer. This OTDR may be operated by using the touch screen or the onboard key pad. The touch screen is a resistive style screen and only proper stylus devices should be used when using the touch screen capability.

This guide is written to instruct operation via the onboard keypad. There will be tips throughout the manual to assist with touch screen operation.

## **Precautions**

Optical time domain reflectometers are optical instruments that emit laser radiation and though this level of radiation is not considered a danger, there are safety considerations and certain practices that should be followed.

Please read and follow all warning and caution information noted in this manual.

*There are warnings, cautions and notes posted throughout this manual.*

### **Warning**

A warning alerts to situations that could cause personal injury.

### **Caution**

A caution alerts to situations that may cause damage to the equipment or produce poor testing conditions resulting in inaccurate test results.

### **Note**

A special annotation that will assist the user with operational features.

*There are also a few touch screen tips scattered through this manual, these will assist the user with touch screen operation. They will be preceded by the green text below:*

### **Touch Screen Tip**

## Chapter 2      Safety

**Chapter 3 of this manual is a quick start guide. Prior to using the quick start guide or operating the equipment in any way, it is highly suggested the user reads all safety information.**

**The information in this chapter pertains to safety consideration of OTDRs in general.**

This product has been designed and tested in accordance with the manufacturer's safety standards, and has been supplied in a safe condition.

This document contains information that must be followed by the user to ensure safe operation and to maintain the product in a safe condition. Failure to follow these safety warnings and cautions can result in harm to the user or damage to the instrument.

### **Warning**

Personnel should always be aware when working with fiber optic test equipment that active fibers may be present, therefore infrared optical energy may be present.

### **Warning**

Never look directly into the end of a connected fiber optic cable or fiber optic interface of optical test equipment, to do so could expose the user to laser radiation and could result in personal injury.

### **Warning**

To Prevent Fire or Shock Hazard:

- Do not install battery types other than those supplied by the manufacturer
- Do not use the charger without the proper batteries installed
- Do not expose the battery charger to rain or excessive moisture
- Do not use the AC adapter when there are signs of damage to the enclosure or cord
- Ensure that you are using the correct charger for the local line voltage
- Do not use any other charger than the one provided with this instrument.
- Do not puncture batteries.
- Do not incinerate batteries.
- All batteries should be disposed of in a proper manner.

**Failure to follow these caution statements could cause unsafe conditions for the operator and equipment and may void the warranty.**

## Chapter 2      Safety

*Failure to follow these cautions statements may void the warranty of, or cause damage to this equipment.*

### **Caution**

Fiber-optic connectors are easily contaminated or damaged. The connection to the OTDR is physical contact type of connections and dirty or damaged connectors may impair the instruments capabilities at minimum and at worst result in the need to return the OTDR to the factory for expensive repairs. Prior to making any connection to the unit, ensure that all proper cleaning procedures have been followed. Use UPC Finish Connectors Only -- DO NOT insert APC connectors into the optical ports.

### **Caution**

The OTDR is equipped with a protection circuit to avoid damage from live fiber connections, the instrument will not operate properly with active fibers. Even with this protection, high power output from EDFA's or other equipment can damage detectors and should never be connected to the OTDR.

If a live fiber is connected to the OTDR and a scan is attempted, a warning dialog will be displayed as in fig. 2.1. Immediately remove the live fiber from the OTDR and press select to clear the message.

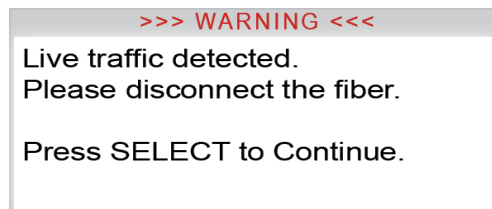



Fig 2.1




## Chapter 3 Quick Start Guide



Prior to using this quick start guide or operating the equipment in any way, it is highly suggested the user reads all safety information in chapter 2.

Press  to turn on the OTDR.


Use the directional buttons to highlight the OTDR icon and press  to enter the OTDR function.

Connect the fiber to the appropriate port. (SM or MM OTDR Optical Port)

Press  to enter the Menu mode. The menu is displayed at the top of the screen. (To hide the menu, press the menu button a second time.)




Use the right button to highlight the  (wavelength) icon and use  to cycle to the desired wavelength.



### If approximate fiber length is unknown:

Press  to have the OTDR start a test using the selected wavelength, allowing the OTDR to determine the most appropriate range and pulse width. (Autotest will set the averaging time to 60sec.)


### If approximate fiber length is known:

 
Set the Wavelength as above and further set the range, pulse width and averaging time.

 

Press  to open the icon menu, use the left or right arrow to highlight the  (range) and use  to cycle through the available ranges of 250m, 1km, 4km, 16km, 64km, 128km or 256km.




Use the left or right buttons to highlight the  (pulse width) icon and use  to cycle through the available pulse widths of 5ns, 10ns, 30ns, 100ns, 300ns, 1us, 3us, 10us or 20us. (Not all pulse widths will be available, only pulse widths appropriate for the selected range will be presented )

## Chapter 3 Quick Start Guide

Press the left or right button to highlight the  $\Sigma$  (average) icon and use  to cycle to the averaging times of Real-Time, 15 seconds, 1, 4, 16 or 40 minutes.

Press  to exit the menu mode and hide the menu bar.

Press  to start a trace. Pressing the  again will stop a trace. To operate the cursors, use the left and right buttons. Press the A/B button to toggle between A and B as the active cursor.







To view the Fib-R-Map and event table, press , use the left and right buttons to highlight the  (schematic view) icon and press .

### Touch Screen Tip

Alternately, the touch screen may be used to select the event table or the Schematic view by touching the tabs immediately below the grid scale.

### Note

The OTDR tab displays the trace with the parameters listed and loss and distance measurements displayed. The Event tab displays the trace with numbered events and an interactive event table, while the Schematic tab displays the trace with numbered events and the interactive Fib-R-Map schematic view of the data.

To save a trace, press the  button and use the left or right buttons to highlight the  (file storage) icon and press . Press , press  and with save highlight press . Use the touchscreen keyboard to enter the file name and touch save.

### Touch Screen Tip

The onboard QWERTY keyboard is only operational with the touch screen capability.

### Note

The Quick Save icon may also be use to save the trace. Touching the Quick Save icon will store the trace to the active project folder and use the last base file name entered.

## Chapter 4      Introduction

Dear Valued Customer,

Thank you for choosing Fiber Instrument Sales Inc. for your fiber optic testing requirements. Our professional staff is available to answer any questions or provide assistance that you require. We, at Fiber Instrument Sales, strive to provide premier customer care and technical support by providing timely responsiveness and training. We are proud of our quality and high standards and assure you, the most user friendly and affordable fiber optic solutions to meet individual needs.

## Chapter 5 Inspection and Identification

### 5.1 Inspection

Before shipment, this instrument was inspected and found to be in perfect working order and free of defects.

The shipping carton contains the following:

1. OTDR with Protective boot
2. Universal AC/DC charger with interchangeable mains
3. USB cable
4. Manual and CertSoft software on CD.
5. Set of interchangeable OTDR adapters, SC, ST and FC and Power Meter adapters for SC, ST, FC, 1.25 universal and 2.5 universal.

#### Note

ST OTDR adapters are not supplies with PON or CWDM OTDRs)

### 5.2 Identification and Configuration

The instrument's Model/Part Number, Serial Number and Date of Manufacture are indicated on a label located on the back of the unit. The instrument's history is filed at the factory by model/part number and serial number. The unit's serial number is also located on the top plate just above the USB Port.


 Conforms to DHHS Standards for Laser Products PER 21 CFR 1040 CE Made In The USA 800-500-0347		Fiber Instrument Sales Inc. Oriskany NY 13424	
Model		OVR-8513	
Serial #		3116	
Wavelength		850/1300nm	
MFG Date		6/30/2014	

Fig 5.1

## Chapter 6 OVR Description

### 6.1 OTDR Physical Description

#### Instrument Enclosure

The FIS OVR is packaged in a rugged housing which is further protected with a rubberized boot. Although the front panel is weather resistant, care must be taken to avoid liquids and contaminants around the fragile optical and electrical connectors, and the glass display. Use a mild cleaning agent and soft damp cloth to clean up the panels and the outside case. See the maintenance section to clean the optical connector. NEVER open the instrument for cleaning. Return to the factory for servicing if necessary.

#### Front View



Fig 6.1

#### Top View

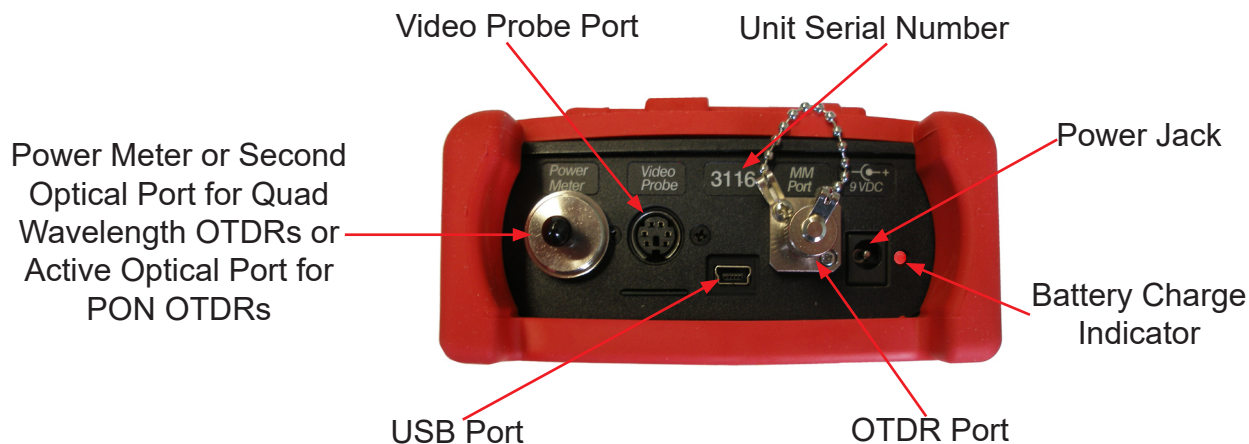


Fig 6.2

## Chapter 6 OVR Description

### 6.2 Home Screen Display

This unit is equipped with a 4" color TFT resistive touch display. Keyboard functions are also executable on the touch screen.

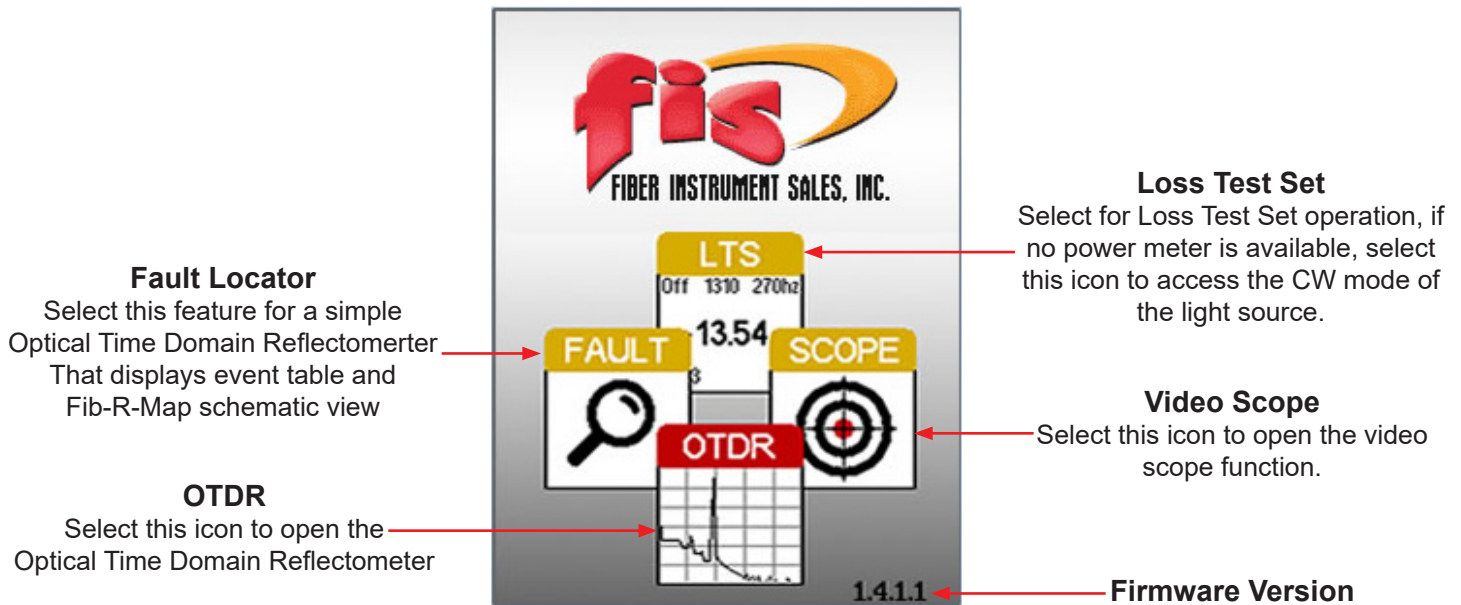


Fig 6.3

### Touch Screen Tip

These icons may be selected with the touch screen function.

### 6.3 Power Requirements

The OVR is equipped with either 4-AA NiMH Batteries or with a 2600mAh Li-ion battery.

The 4 NiMH batteries require a 100-240V-0.3A input and 9V, 0.67A center positive output universal AC/DC battery charger. A fully charged NiMH batter pack will enable about 4 hrs. of use and require 6-8 hours to recharge.

The Li-ion batteries require a 100-240V-0.6A input and 15V, 1.2A center positive output universal AC/DC battery charger. A fully charged Li-ion battery pack will typically enable approximately 9 hrs. of use and require approximately 2 hours of recharging.

The appropriate charger is supplied with each OTDR and it is clearly labeled above the charge port on the OTDR, which charger is required. These chargers are supplied with interchangeable mains for US, Great Britain, Europe and Australia.

## Chapter 6 OVR Description

### 6.4 Battery Replacement

The OVR is equipped with either 4 AA NiMH batteries or a Li-ion battery pack.

#### **4 AA NiMH**

To replace the batteries, remove the OTDR from the protective boot by pulling the bottom of the boot down and back allowing the bottom of the unit to be lifted out. The battery door is located on the back side of the unit. Replace the batteries with only high quality AA NiMH batteries. Spare battery packs are available with a charging unit for extended battery operation. If you install NiMH batteries that are dead or less than 1 volt each, charge these batteries for one (1) hour before using the OTDR. For proper maintenance, batteries require a monthly recharge.

#### **Li-ion Pack**

The batteries not field replaceable. An RMA should be acquired and the unit must be returned to the factory for battery replacement. This Li-ion battery pack should not be punctured, incinerated or disposed of improperly.

### **Warning**

To Prevent Fire or Shock Hazard:

- Do not install battery types other than those supplied by the manufacturer
- Do not use the charger without the proper batteries installed
- Do not expose the battery charger to rain or excessive moisture
- Do not use the AC adapter when there are signs of damage to the enclosure or cord
- Ensure that you are using the correct charger for the local line voltage
- Do not use any other charger than the one provided with this instrument.
- Do not puncture batteries.
- Do not incinerate batteries.
- All batteries should be disposed of in a proper manner.

**Failure to follow these caution statements could cause unsafe conditions for the operator and equipment and may void the warranty.**

## Chapter 7 Fault Locator Operation

The Fault Locator is a simple autotest feature which displays the test results in event table with the Rib-R-Map schematic view. The fault locator will take a scan of the fiber in auto test mode. The user sets the wavelength to be tested and the OTDR will set the pulse width and range to best suite the fiber under test at the selected wavelength. The average time will be set to 15 seconds.

To enter the Fault Locator mode, touch the FAULT icon on the home screen. The screen below will be displayed.

### 7.1 Fault Locator Screen

The fault locator screen includes the event table, Fib-R-Map (Schematic View) and event map view of highlighted event.

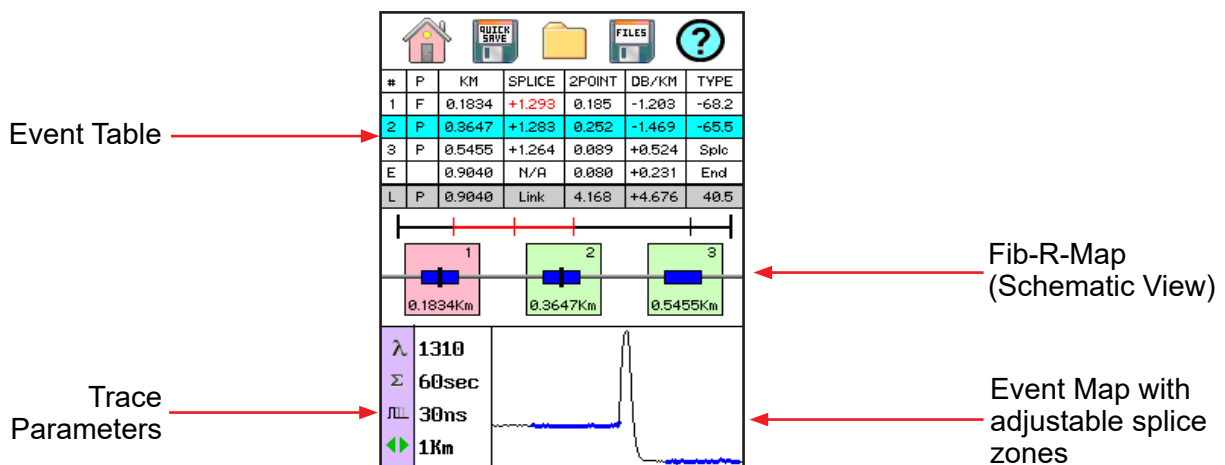


Fig 7.2

### Fib-R-Map

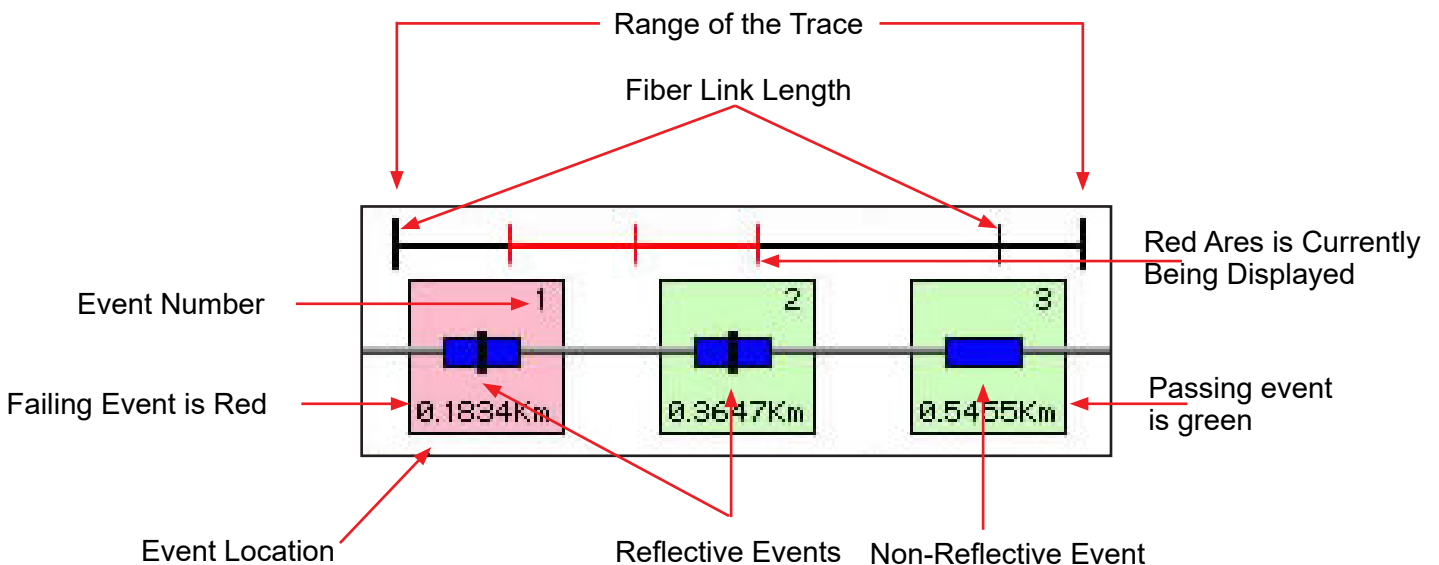


Fig 7.3



## Chapter 7 Fault Locate Operation

### Note

The End of Fiber is the last item in the schematic view. It is labeled E in the event number position and displays a vertical Bar instead of horizontal.

### Event Table

#	P	KM	SPLICE	2POINT	DB/KM	TYPE
1	F	0.1834	+1.293	0.185	-1.203	-68.2
2	P	0.3647	+1.283	0.252	-1.469	-65.5
3	P	0.5455	+1.264	0.089	+0.524	Splc
E		0.9040	N/A	0.080	+0.231	End
L	P	0.9040	Link	4.168	+4.676	40.5

Annotations:

- Event Location: Points to the KM column.
- Event Loss in dB: Points to the SPLICE column.
- Loss Between Previous and Current Events: Points to the 2POINT column.
- dB Per/Km, Kf or Mi Between Events: Points to the DB/KM column.
- Pass/Fail: Points to the P column.
- Event Number: Points to the # column.
- Event Type or Reflectance Value: Points to the TYPE column.
- EOF Event Information: Points to the E row.
- Link Information: Points to the L row.
- Link Loss: Points to the 2POINT value in the L row (4.168).
- Link dB Per/Km, Kf or Mi: Points to the DB/KM value in the L row (+4.676).
- System ORL: Points to the TYPE value in the L row (40.5).

Fig 7.4

### Event Table Field Description

#### # Event Number:

Indicates the event in sequence, where the higher the number the further distance from the OTDR the event occurs. "E" (End) which is the event determined to be the end of the fiber under test. The last column is labeled "L" the row included data that is relevant to the link (full fiber under test).

#### P:

Pass/Fail, if any one of the thresholds are not met for an event, the P/F column will display an F. The parameter that failed will be displayed in red. If all the parameters are met, this column will display a P. There is no Pass/Fail threshold for the last event labeled "E" (End) and the Pass/Fail for the "L" (Link) row includes the 2POINT column, which for the link is the total link loss and the TYPE column which for the link row is the system ORL.

#### Km or KF or MI:

Event Location (Distance from OTDR), Labeled Km for Kilometer or KF if unit of measure is Kilo-feet MI for mile. This is the distance/location that the event occurs along the fiber link. This data should be the same for the End of Fiber and Link.

## Chapter 7      Fault Locate Operation

### **Splice:**

SPLICE is the dB loss at the event at this location on the fiber. Loss is represented as a positive number. (A positive number is the amount of loss and a negative number indicates a gain normally due to mismatched index of refraction.) This is a settable threshold for the Pass/Fail purposes. The "E" event will display LINK as this is not an event that would have meaning. The event that is deemed the EOF will normally display a large loss as this loss will be greater than the threshold set to determine the end of the fiber.

### **2POINT:**

2 Point Loss is the loss measured from the end of the dead zone of the previous event to the beginning of current event. The value in the "L" line of the table for this column is the link loss. The loss from the beginning of the trace to the event determined to be the EOF. This is the value used to determine if the fiber link passes or fails it's loss threshold.

### **dB/Km:**

dB per Kilometer if in KM and DB/KF if in Kilo-Feet and DB/MI if in mile unit of measure. This is the calculated loss per Km, Kf or Mi from the end of the dead zone of the previous event to the beginning of the current event. The value in the "L" line of the table for this column is the dB Per/KM, Kf or Mi for the total link.

### **TYPE:**

Event Type is the type of event or the return loss of an event. If the event has no reflection, "splc" will be displayed and if the event is reflective, the reflectance value will be displayed. For the last event which is labeled "E", there is no value displayed, it simply shows "End" and in the "L" row, the Optical Return Loss for the link is displayed (System ORL).

## 7.1 Fault Locator Operation

### **Set Wavelength**

To select the wavelength to be tested, touch the wavelength indicator as shown in Fig. 7.1 above, this will cycle through the available wavelengths on the OTDR.

### **Start Scan**

To start a scan, touch in the bottom right corner of the display. A "Please Wait, Scanning" message will be displayed. The scan will take about 15 seconds.

### **Exit Fault Locator Mode**

To exit the fault locator mode double touch in the event table area or press the Menu button.

### **Note**

When a scan is taken with the Fault Locate, the trace information is temporarily stored in the OTDR. If the full trace needs to be viewed, double touch in the event table area or press the Menu button to return to the home screen. Touch the OTDR icon and the trace will be displayed with full OTDR operation.

## Chapter 8 OTDR Operation

### 8.1 Key Pad



Power button, turns the unit On and Off. (Hold for 1 second)



Scan button starts a scan or stops scan.



AutoTest button operates range finder mode and construction modes.



The Menu button displays and hides the icon menu at the top of the display. It will also back out of most menu selected screens. In the project folder and file manager it opens the file/edit menu bar. When the menu is displayed at the top of the screen, the focus of the LRUD buttons and the select buttons are on the icon menu and no longer on the trace cursors.



 
Toggles between A and B as the active cursors.



Selects the Zoom level, each press cycles to the next zoom level. Zoom levels are 1x, 2x, 4x, 8x, 16x and 32x.



In the menu mode, the select button actuates highlighted item.



While in the trace mode the directional buttons are used to move the cursors. In the Menu mode, the Left and right buttons move between the icons. The up button hides the menu bar or moves cursor up in drop-down menus and the down button opens, drop-down menus or move cursor down while in a drop-down menu.



Fig 8.1
















## Chapter 8 OTDR Operation

### 8.2 Entering OTDR Function

Press the power button to turn on the OVR.

Use the LRUD button buttons to highlight the OTDR icon and press the select button to enter the OTDR function, or touch the OTDR icon.

### 8.3 Icon Definitions

	Home	Brings the user back to the home page
	Quick Save	Saves the current trace to the current folder, with numeric suffix using last named file
	Quick Load	Recalls the next file, in reverse order, chronologically in the current folder.
	Tool Menu	Opens tool Menu
	Project Folder	Opens project management
	File Manager	Opens file management
	Event Analysis	Opens the event analysis screen w/Fib-R-Map
	Settings	Opens the parameters setting page.
	Splice Zone Setting	Turns on LSA/Splice markers
	Help	Opens the context sensitive help menu
	Lambda (Wavelength)	Cycles through available wavelengths
	Averaging	Cycles through averaging times
	Pulse Width	Cycles through available pulse widths
	Range	Cycles through available test ranges
	Index of Refraction	Opens the Index of Refraction entry screen

## Chapter 8 OTDR Operation

### 8.4 Main OTDR Screen

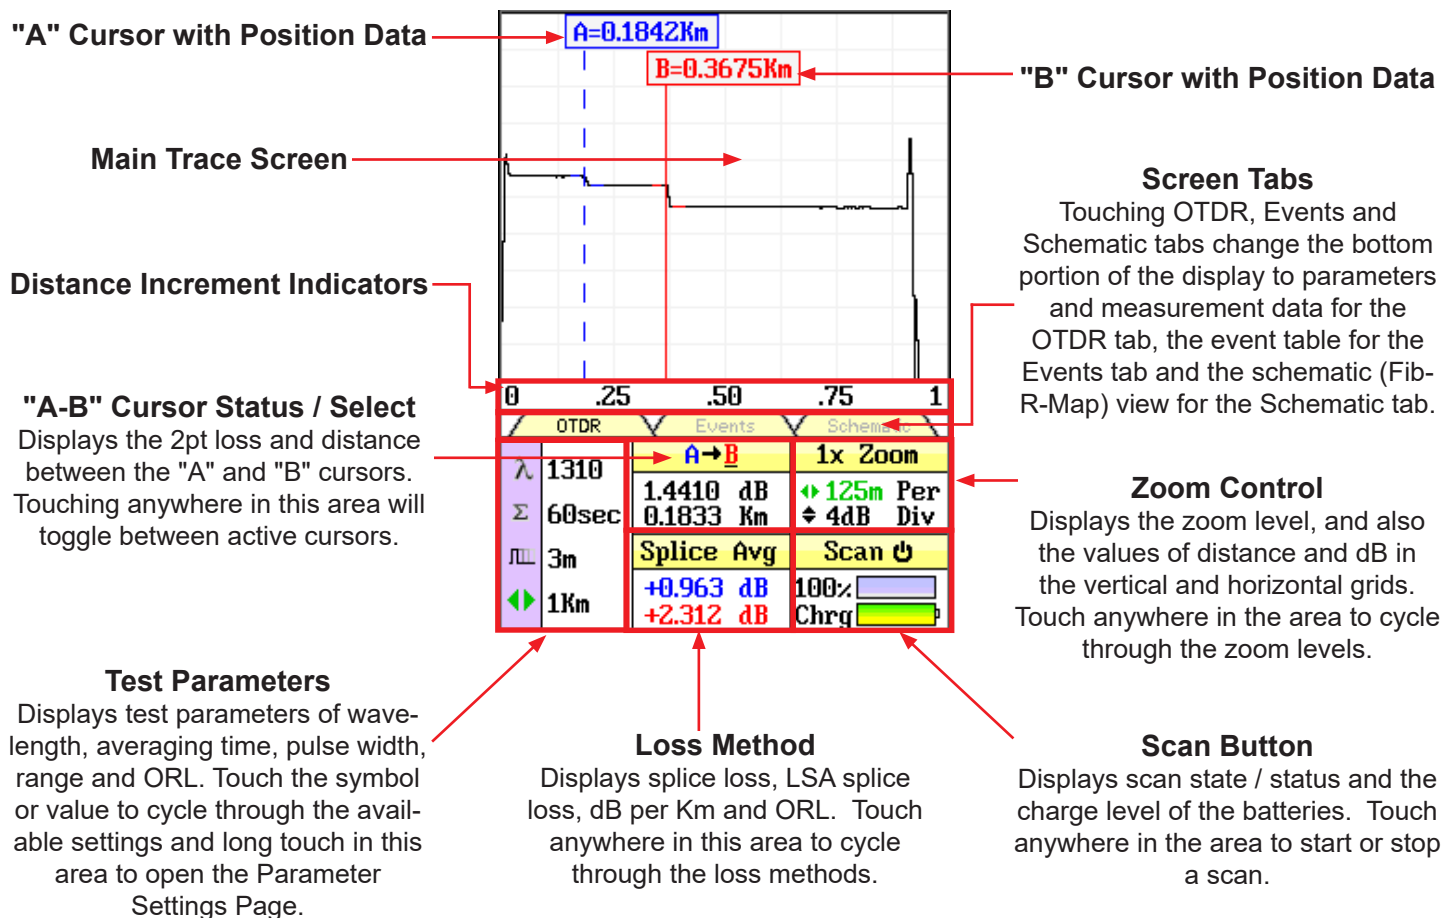


Fig 8.2

### Touch Screen Tip

Use the touch screen to snap cursors to a position by touching that point along the trace curve. The active cursor will move directly to that point. For finer movement, touch active cursor and drag it to the desired position. Finest movement can be accomplished with the LRUD buttons on the keypad.

### Touch Screen Tip

All the test parameters may be change by touching the value on the touch screen. A long touch in the test parameter section of the screen will open the parameter settings page. A/B cursor, zoom, loss method and scan may all be operated with the touch screen.

## Chapter 8 OTDR Operation

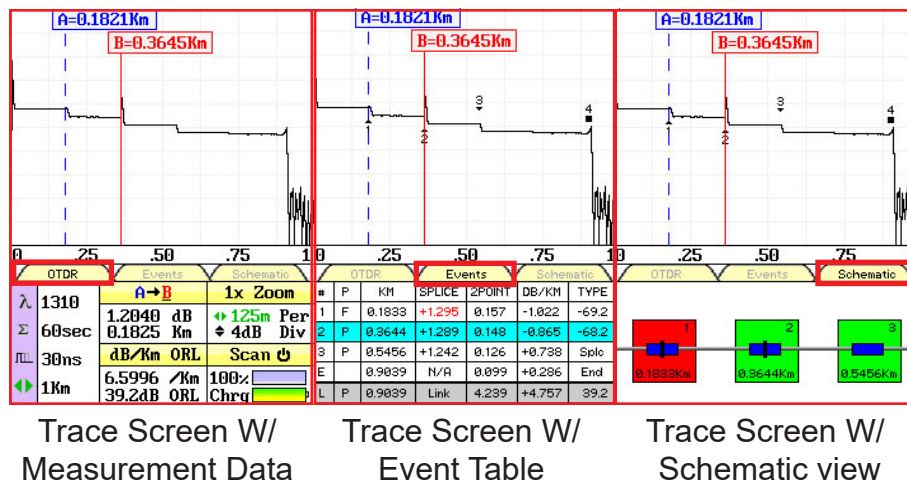


Fig 8.3

There are three tabs on the main OTDR screen. OTDR, Events and Schematic. Use the OTDR tab to view the trace with the loss and distance measurements. Use the Events tab to view an interactive event table with the trace and numbered events or the Schematic tab to view an interactive schematic view of the events with the trace and numbered events. In Events tab, the up and down buttons and in the Schematic tab, the left and right buttons may be used to snap the active cursor to previous or next event.

### 8.5 OTDR Parameter Settings Screen

To access the parameter settings screen press the menu button, use the LRUD buttons to highlight the setting icon and press the select button to set the parameter. An alternate manner to open this screen is to long touch the test parameter section of the main OTDR screen.

#### Touch Screen Tip

All operations on this page are accessible via the touch screen. To change parameters or event sensitivity, simply touch the desired value to select. The block will change to green to indicate it is now the selected value. To set thresholds and the 24 hour clock, touch one of the arrows above or below a digit. Moving off the threshold category locks in the setting.

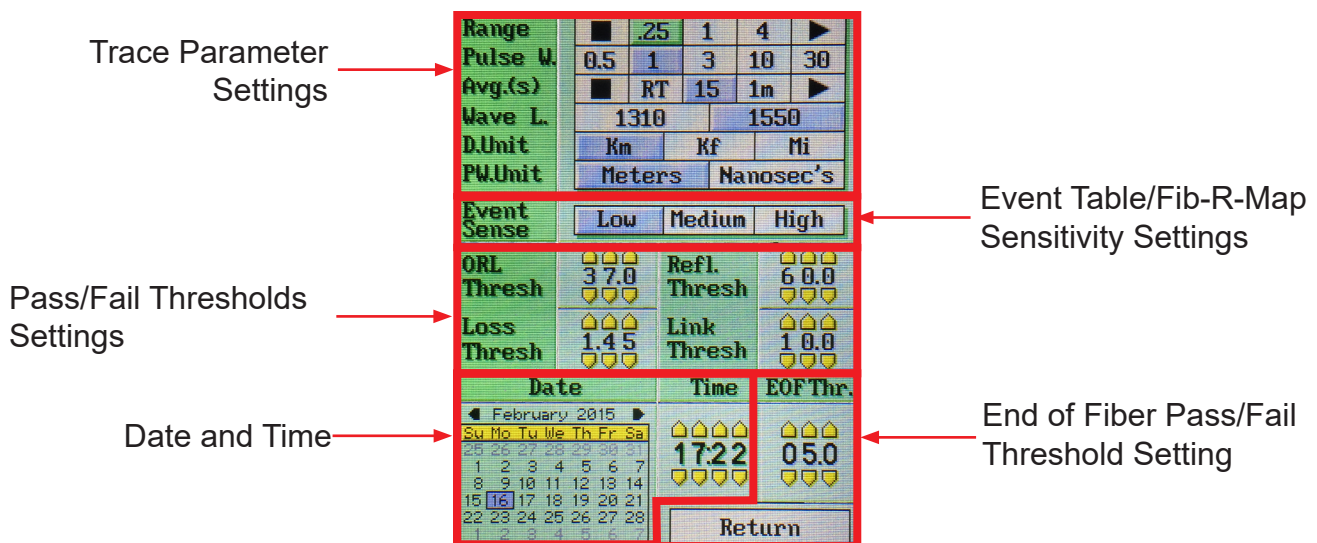


Fig 8.4



## Chapter 8 OTDR Operation

### **Trace Parameter Settings**

When using the keypad, the cursor is yellow. When the LRUD buttons are used, a yellow cursor will move through the available values. Use the Select button to select the yellow highlighted value. Once a value is selected, it will show green, until the yellow cursor is moved from that area and then it will show blue for a active value.

There are two additional setting in this area that are not available on the main OTDR screen, distance unit and pulse width unit.

### **Touch Screen Tip**

When using the touch screen feature, simply touch the desired parameter to select it.

### **Note**

An arrow at the beginning or end of a list indicates additional setting are available. A black square at either end indicated the end of the list.

### **Event Table/Fib-R-Map (Schematic) Sensitivity Settings**

When using the keypad, the cursor is yellow. When the LRUD buttons are used, a yellow cursor will move through the available values. Use the Select button to select the yellow highlighted value. Once a value is selected, it will show green, until the yellow cursor is moved from that area and then it will show blue for a active value.

### **Pass/Fail Threshold Settings**

There are five pass/fail thresholds that may be set. Use the LRUD buttons to move between threshold categories, once a categories is highlighted, press select to change the focus of the LRUD buttons and highlight the first digit in the setting. Use the up/down button to make changes to the highlighted digit and the left/right buttons to move to another digit. Once the desired value is entered, press selected again and the LRUD buttons may be used to move off that threshold. Continue until all thresholds settings have been completed. When using the touch screen, simply touch the up or down arrows of a digit to make changes.

### **Note**

There is an ORL and a Reflection Threshold setting. The ORL is the return loss for the entire link/system and Reflection threshold is the return loss value of an event.

### **Date/Time Settings**

Use the LRUD buttons to highlight the calendar month and press select. Use the left and right buttons to change the month and press select. Use the LRUD buttons, highlight the date and press select. With the touch screen, uses the arrows on either side of the month to set the month then touch the correct date.

Use the LRUD to buttons to highlight the clock and press select. Use the up/down buttons to make changes to the highlighted digit and the left/right buttons to move the another digit. Once the correct time is entered, press select. With the touch screen, uses the up and down arrows for each digit to set the time.

### **Exit Parameter Setting Screen**

Press the menu button or touch Return to exit the parameter screen.

## Chapter 8 OTDR Operation

### **Warning**

Before connecting a fiber to the OTDR, be certain the fiber has no active optical sources or instruments connected to the other end. Skin or eye damage could result from high power sources such as EDFAs, and instrument damage could occur voiding the warranty.

### **Warning**

Clean all connectors in use thoroughly prior to connection to the appropriate port of the OTDR. Failure to ensure the connectors used with the OTDR are properly cleaned can result in poor launch conditions at the minimum or damage to the optical interface that requires the unit be returned to the factory for repair.

## 8.6 Auto Test

Auto Test is a useful feature when the approximate length of the fiber to be tested is unknown. To use the AutoTest, only the IOR and Wavelength need to be set by the user.

### **Note**

To assist in obtaining reliable, consistent measurements, the user should be aware of the Index of Refraction of their fiber. The proper Index of Refraction (IOR) will maximize the distance measurement accuracy. The IOR is proportional to the speed of light in glass compared to the speed of light in a vacuum and can be calculated using the equation  $IOR = C$  (the speed of light in a vacuum) /  $V$  (the speed of light in fiber). The IOR number can be obtained from the fiber or cable manufacturer or can be calculated with a known length of cable. IOR numbers generally fall around 1.468 SM, 1.486 MM. These are the default values in the OTDR, but can be adjusted from 1.0 to 2. If this is unknown it is best to use the default setting on the OTDR.

### **Set IOR**

It is necessary to have the Index of Refraction set as close as possible to the actual IOR of the fiber. If this is unknown it is best to use the default setting on the OTDR. To view the current IOR for a wavelength, open the menu use the left/right button to highlight the IOR Icon. Press select and the IOR for the wavelength that is the active will be displayed. To change the IOR, use the on screen QWERTY keyboard to enter the new value and touch save. Each wavelength stores an independent IOR.

### **Set Wavelength**

To select the wavelength, press the menu button to display the menu at the top of the display. Use the LRUD buttons to highlight the Lambda (Wavelength) icon, press select to cycle through the available wavelengths and press the menu button again to hide the menu. Use only the single wavelength settings for the Autotest feature. Dual wavelength indicators, such as 850/1300 or 1310/1550 are used for construction mode operation.

### **Note**

The wavelengths selections for dual MM OTDR are 850nm, 1300nm and 850/1300nm, for SM OTDR they are 1310nm, 1550nm and 1310/1550nm. For the Quad wavelength OTDR, they are 850, 1300, 850/1300, 1310, 1550 and 1310/1550nm. The 850/1300nm and 1310/1550nm settings are for Construction Mode operation where the OTDR will test both wavelengths in one operation. Construction mode is covered in section 8.8 of this guide.

### **Start Auto Test**

Press the AutoTest button and the unit will conduct a test at the selected wavelength with a 60 Sec. average time, unit selected pulse width and range parameters appropriate for the fiber under test.



## Chapter 8 OTDR Operation

### **Warning**

Before connecting a fiber to the OTDR, be certain the fiber has no active optical sources or instruments connected to the other end. Skin or eye damage could result from high power sources such as EDFAs, and instrument damage could occur voiding the warranty.

### **Warning**

Clean all connectors in use thoroughly prior to connection to the appropriate port of the OTDR. Failure to ensure the connectors used with the OTDR are properly cleaned can result in poor launch conditions at the minimum or damage to the optical interface that requires the unit be returned to the factory for repair.

## 8.7 Manual/Expert Mode

### **Note**

To assist in obtaining reliable, consistent measurements, the user should be aware of the Index of Refraction of their fiber. The proper Index of Refraction (IOR) will maximize the distance measurement accuracy. The IOR is proportional to the speed of light in glass compared to the speed of light in a vacuum and can be calculated using the equation  $IOR = C$  (the speed of light in a vacuum) /  $V$  (the speed of light in fiber). The IOR number can be obtained from the fiber or cable manufacturer or can be calculated with a known length of cable. IOR numbers generally fall around 1.468 SM, 1.486 MM. These are the default values in the OTDR, but can be adjusted from 1.0 to 2. If this is unknown it is best to use the default setting on the OTDR.

### **Set IOR**

It is necessary to have the Index of Refraction set as close as possible to the actual IOR of the fiber. If this is unknown it is best to use the default setting on the OTDR. To view the current IOR for a wavelength, open the menu use the left/right button to highlight the IOR Icon. Press select and the IOR for the wavelength that is the active will be displayed. To change the IOR, use the on screen QWERTY keyboard to enter the new value and touch save. Each wavelength stores an independent IOR.

### **Touch Screen Tip**

All the test parameters may be change by touching the value on the screen to the right of the icon. A long touch in the test parameter section of the screen will open the parameter settings page.

### **Set Wavelength**

To select the wavelength, press the menu button to display the menu at the top of the display. Use the LRUD buttons to highlight the Lambda (Wavelength) icon, press select to cycle through the available wavelengths and press the menu button again to hide the menu. Wavelength may also be set by touching the wavelength indication on the display.

## Chapter 8 OTDR Operation

### Note

When setting the range and pulse width, it is necessary to keep in mind that it may not be beneficial to use certain pulse widths with some ranges. For this reason not all pulse widths are available for use with all ranges. The chart below indicates the pulse widths that are available with each range.

	Pulse Width								
	5ns	10ns	30ns	100ns	300ns	1μ	3μ	10μ	20μ
Range	250m	✓	✓	✓	✓	✓			
	1km	✓	✓	✓	✓	✓			
	4km		✓	✓	✓	✓			
	16km			✓	✓	✓	✓		
	64km				✓	✓	✓	✓	✓
	128km				✓	✓	✓	✓	✓
	256km					✓	✓	✓	✓

### Set Range

To set the range, press the menu button and use the LRUD buttons to highlight the range icon. Use the select button to cycle to the desired range.

### Set Pulse Width

To set the pulse width press the menu button and use the LRUD buttons to highlight the pulse width icon. Use the select button to cycle to the desired pulse width.

### Set Averaging Time

To set the averaging time press the menu button and use the LRUD buttons to highlight the averaging icon. Use the select button to cycle through the averaging times of RT (Real Time), 15, or 60 seconds, 2 or 4, 8 or 20 minutes.

### Touch Screen Tip

The above setting may be made with the touch screen by simply touching the appropriate icon in the icon menu to cycle through the available settings or touching the value indicated in the parameter section of the OTDR screen. The parameter settings page may also be opened to adjust all these settings.

### Scan

Once all the proper settings have been entered, press the Scan button to take the trace. To stop the trace press the scan button again.

## Chapter 8 OTDR Operation

### 8.8 Construction Mode

Construction Mode is useful when a large number of fibers need to be tested with the same settings at multiple wavelengths. This mode tests a fiber at two wavelengths, saves the traces and displays them in dual trace mode.

#### **Create or Open a Project**

Press the menu button, use the right or left buttons to highlight the Project Management folder icon and press select. Use the up and down buttons to highlight the desired project and press Select, or create a new project once you have established all the desired parameters for testing. Create the new project by pressing the Menu button and with File tab highlighted press the down button. Press select with New highlighted and use the onboard QWERTY keyboard to enter the project name and touch save.

#### **Note**

Refer to Chapter 9 of this manual for detailed project management operating procedures.

To enter project details, touch the Details section at the bottom of the projects screen. A dialog will be displayed that allows the user to set the Customer, Date, Operator along with 'to and from' locations if desired. Touch Close at the bottom of the dialog to go back to the projects screen

With the project enter and highlighted, press the Select button. This will open the file management screen.

#### **Set Base File Name**

Once the project folder has been created and or opened, the files folder for that project will be displayed. A base file name for the test should be established. Press the menu button to open the file management menu, with the file tab highlighted, press the select button or the down button to open the drop-down menu. With save highlighted press the Select button. Use the QWERTY to enter a base file name.

When testing in construction mode, files will be save in numeric order with the first two digits of the wavelength added to the end of the file name. For example, if the base file name of SAMPLE is entered, the first test in construction mode (If the test were at 1310/1550nm) would be a test at 1310nm with a name of SAMPLE.1.13 and the second test would be the same fiber at 1550nm with a name of SAMPLE.1.15. The next tests would be SAMPLE.2.13 and SAMPLE.2.15,..... If a fiber number other than one was to be tested, the base file name should have a .X added. For example, if the test was to start at fiber 15, the base file name should be SAMPLE.14. When the construction mode test is completed, the files saved will be SAMPLE.15.13 and SAMPLE.15.15.

After selecting save ensure that project name is moved to the center blue highlighted are of the project list and press select to set that project as active and to use the parameters set with that project.

Once the base file name is set, exit the file manager by pressing the menu button, pressing select on the file tab, using the down button to highlight exit and pressing select.

## Chapter 8 OTDR Operation

### **Set the Wavelengths**

On the main trace screen in the OTDR tab the wavelength settings are accessible. There are wavelength settings available here that are not in the parameters setting screen. Dual wavelength OTDRs will have one extra setting of a combination of the two wavelengths. For example, if the OTDR is a 1310/1550nm dual wavelength unit, there will be three available selection here. 1310, 1550, and 13/15. The 13/15 is used for constructions mode. This needs to be selected anytime construction mode is to be used. Quad wavelength units will have 850, 1300, 1310, 1550, 85/13 and 13/15, where either 85/13 or 13/15 may be use for construction mode testing. Use the touch screen to cycle through these wavelength settings.

### **Start A Test**

To start the test connect the fiber to be tested to the proper OTDR port and press the scan button.

The OTDR will test the fiber at the shorter wavelength, display the trace and save the file. It will then test the fiber the longer wavelength, The longer wavelength will become the primary trace and the two test will be displayed in dual trace mode.

When the test is complete for the first fiber, remove the connector from the OTDR, connect the next fiber to be tested and press the scan button. Continue until all test are complete.

### **Note**

Macrobend tests are automatically conduct with construction mode. Simply enter the Events tab on the OTDR screen or open the event analysis screen through the icon menu. For information about marobend analysis, please refer to section 8.12 of this guide.

### **Exiting Construction Mode**

To exit construction mode, set the wavelength on the trace screen to a single wavelength and start a scan.

## Chapter 8 OTDR Operation

### 8.9 Trace Analysis

#### Unit of Measure

The distance unit of measure may be displayed in Kilometer (Km), Kilo feet (Kf) or Miles (Mi). To set the unit of measure, press the menu button, use the LRUD buttons to highlight the settings icon and press select to open the parameter screen. Use the down button to move the cursor to the D.Unit line in the parameter menu, and use the left or right button to highlight the desired unit of measure and press select. Press the menu button or touch Return to exit the parameter settings page.

#### Note

When in the Kilo feet (Kf) mode, the distance measurements are displayed in feet for the 820 foot and the 3.2 Kf ranges. All longer ranges have the distance measurements displayed in Kf.

#### Zoom

There are six zoom levels, 1x, 2x, 4x, 8x, 16x and 32X. To change the zoom level, press the zoom button on the keypad. This will cycle through the six levels. When viewing the trace at a zoom level other than 1x, the active cursor is centered on the trace display and when the cursors are moved, the trace moves and the cursor will remain centered.

#### Cursor Movement

The active cursor is displayed as a solid line and the non-active cursor as a dashed line. Pressing the A/B button on the keypad toggles between the two cursors as the active cursor. The cursors are moved using the left and right buttons.

#### Touch Screen Tip

Use the touch screen to snap cursors to a position by touching that point along the trace curve. The active cursor will move directly to that point. For finer movement, touch active cursor and drag it to the desired position. The finest movement can be accomplished with the left and right buttons.

### 8.10 Loss Measurements

#### 2 Point loss

2 Point loss measurements take into account the difference in vertical height between where the A and B cursors cross the fiber trace. This information is located on the main OTDR screen in the A-B section of the trace information as shown in Fig. 8.2. This is a quick method of checking the loss between any two points on a fiber optic link.

#### dB/km

The dB/Km (dB/Kft or dB/Mi) loss method takes the 2 Point loss in dB and divides by the distance between the cursors in Km (Kilometers), Kf (Kilofeet) or Mi (Miles). For accurate dB/... loss measurements, the two cursors must be on level backscatter points at least 100m apart. (NA will show for distances that are not sufficient for measurement).

## Chapter 8 OTDR Operation

### Optical Return Loss

This Optical Return Loss (ORL) is separate from the event ORL (Reflectance) that is displayed in the event analysis under the TYPE header for an individual event. The measurement displayed in the loss measurement area of the main OTDR screen and in the L (Linki) row in the TYPE column is an optical return loss based on the entire link. It is the total accumulated light reflected back to the source along the fiber optic link.

### Basic Splice Loss

Splice Loss method is meant to be used in noisy environments when it is difficult to attain an LSA area that lays flat on the back scatter before and after the cursor. This method takes an average of the selected points before and after the active cursor and uses this average to make a good estimation of the event loss. This is an estimation but this method may be more accurate than LSA Splice Loss method in noisy environments.

When using the splice loss It is necessary to set the splice loss areas in clear backscatter. (areas that do not consist of other events) For accurate splice loss measurements, set a cursor at the beginning of an event and set splice loss measurement areas as shown in Fig. 8.6. Splice loss measurement areas will follow the undulations of the back scatter line unlike LSA areas.

### Least Squares Approximation (LSA)

Least Squares Approximation (LSA) Splice loss method gives the user a visual aid in setting splice loss areas. This method can be more accurate by affording the ability to see the slope of the splice loss areas, however: it can also supply a reading with greater error if not used properly. The splice loss lines must be set to overlay the backscatter of a trace without over lapping any other events. Unlike basic splice loss, LSA measurement areas are drawn as straight lines without regard to the undulations of the back scatter

## 8.11 Loss Measurement Settings

### Touch Screen Tip

The loss measurement/LSA areas may only be set with the key pad. Use the touchscreen menu to enter the LSA settings function, but once there, use the key pad to adjust the areas as described. It is necessary to be zoomed in on an event to set the loss measurement areas.

### Setting Splice Loss Measurement Areas

To set the basic splice loss measurement/ LSA areas, the OTDR must be in Splice AVG or Splice LSA mode. To adjust the splice loss areas around the cursors, press the menu button, highlight the LSA icon and press select. The splice loss position indicator will be displayed at splice loss position number 1 as indicated in Fig. 8.6. Use the left and right buttons to adjust the loss measurement area. Press the select button to move the splice loss position indicator to the position number 2, set the area and continue with positions 3 and 4 in the same manner. Press select when done with position number 4 to hide the splice loss position indicator and reset the focus of the keyboard back to the cursors. Press the menu button at any time to escape the splice loss settings sequence.

### Note

It is necessary to set these areas in clear backscatter to acquire the most accurate measurements, they must not include other events.

# Chapter 8 OTDR Operation

## Splice Loss Measurement Areas

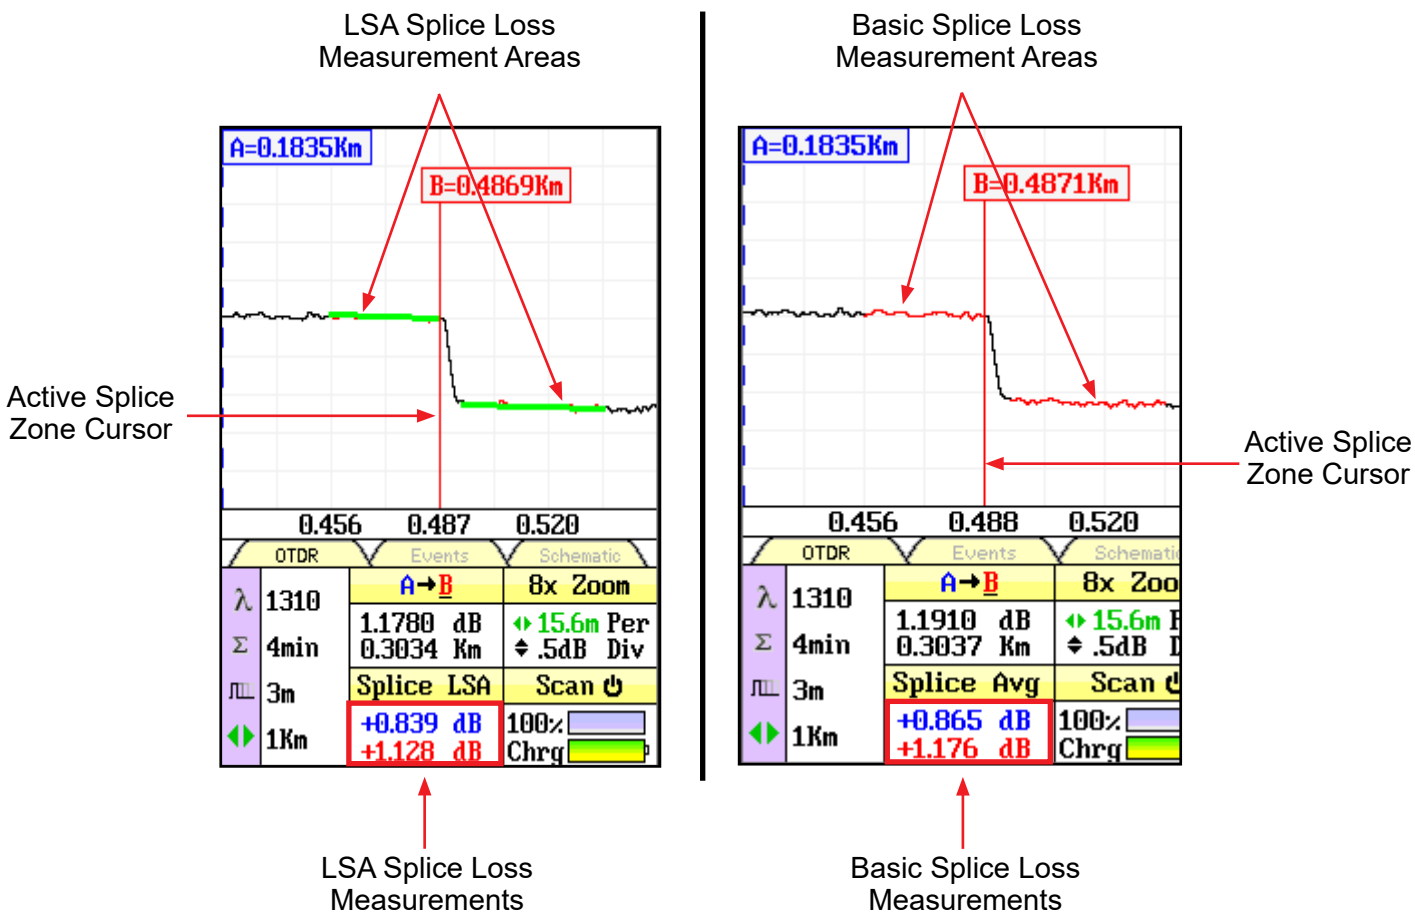


Fig 8.5

## Splice Loss Adjustment Positions

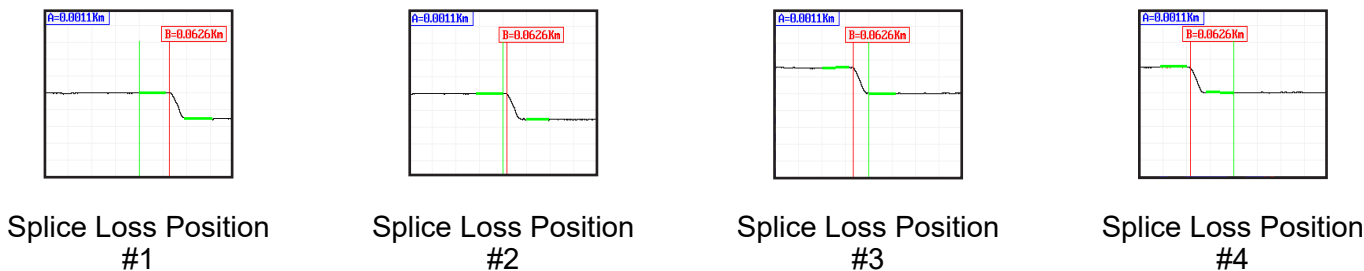


Fig 8.6

### Note

The vertical green line is used to show which point of the LSA measurement areas is the focus of the left and right buttons. To move to the next point, press the Select button.

## Chapter 8 OTDR Operation

### LSA Examples

LSA Set Too Early:

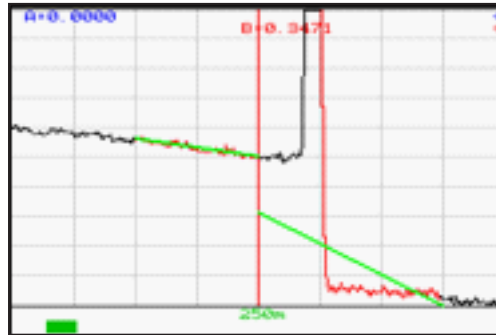


Fig 8.7

The LSA area and cursor are set too early. The right green LSA indicator line is not over laying the back scatter of the trace properly.

LSA Set Too Late:

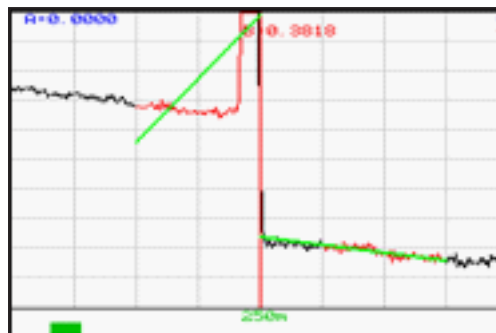


Fig 8.8

The LSA area and cursor are set too late. The left green LSA indicator line is not over laying the back scatter of the trace properly.

Proper LSA Setting:

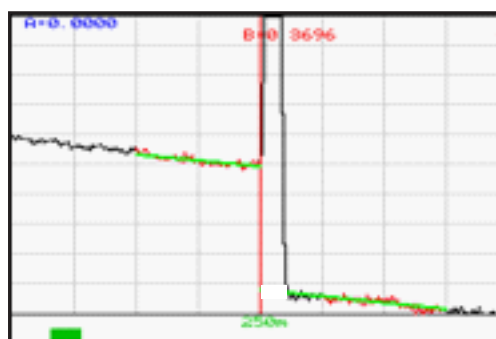


Fig 8.9

The LSA area and cursor are set properly. The green LSA indicator line is over laying the back scatter of the trace properly.



## Chapter 8 OTDR Operation

### 8.12 Event Analysis

#### **NOTE:**

When using the event table and the Fib-R-Map (Schematic view), it is necessary to keep in mind that event analysis provides approximate loss and distance measurements to quickly assist in network evaluation. Automatic detection results are not guaranteed and have their limits, possibly causing erroneous readings or detection failure. User interaction, by interfacing with the trace display is recommended for final qualitative and quantitative analysis.

#### **Enter Event Analysis**

To enter event analysis, press the menu button and use the left / right buttons to highlight the event analysis icon and press select.

#### **Threshold Settings**

There are five threshold settings, ORL, Loss, Reflectance (Refl.) Link and End OF Fiber (EOF). (See Fig 8.4) The EOF is not a Pass/Fail threshold, it is used to set a loss value to determine the end of fiber. IF the EOF threshold is set for 3dB, then the first event that has a loss of 3dB or greater will be determined to be the EOF.

To change the threshold settings, press the Menu button, use the left/right buttons to highlight the settings icon and press select. Use the down button to move the cursor to the threshold setting to be set.

#### **NOTE:**

The cursor will be displayed as yellow when not on a selected value and green when on a value that is already a selected parameter..

When the threshold value is selected with the yellow background, press Select to highlight the first digit in the setting. Use the up or down buttons to make a change and the left or right buttons to move to the previous or next digit. When the value is set as desired, press the Select button and use the directional buttons to move to the next threshold to be set. To exit the parameter screen, press the menu button.

#### **NOTE:**

Thresholds are "pass thresholds", a value entered as a threshold is a passing value.

#### **Touch Screen Tip**

With the touchscreen, touch the arrows above or below any digit to make changes.

Examples of these settings are as follows:

- |         |   |
|---------|---|
| Splice: | If a 1.00dB splice loss is acceptable, set the threshold to 1.00. If a splice loss of 1.00 is the fail point, set the threshold to 0.99 |
| ORL:    | If a -50dB reflectance is acceptable, set the threshold to 50. If -50dB is the fail point, set the threshold to 50.5.                   |
| Link:   | If a 20dB, link loss is acceptable, set the threshold to 20. If 20db link loss is the fail point, set the threshold to 19.5.            |

## Chapter 8 OTDR Operation

### Sensitivity Settings

There are three levels of sensitivity for the event table and Fib-R-Map. (See Fig 8.4) To change the event sensitivity, press the Menu button, use the left/right buttons to highlight the settings icon and press select. The cursor is the yellow highlighted area. (If the yellow cursor is on a value that is the current selection, that block will be highlighted green.) The setting highlighted in blue is the current setting. Use the LRUD buttons to highlight the desired setting and press select. To exit the parameter screen, press the menu button.

The lowest setting possible should be used to help filter out any false events that may be caused by short pulse widths, but are not true perturbations in the optical signal. High sensitivity settings present events with loss down to approximately 0.1dB, Medium (Md) with events down to approximately 0.2dB and Low (Lo) for events down to about 0.5dB. Longer pulse widths, and averaging help to lower the number of false events. Highest sensitivity settings should only be used for traces with high signal level, low noise, long pulse width and long average.

### Macro bend Analysis

Macro bend analysis is performed with the dual trace operation and displayed in the event table. The traces to be compared must have been performed at the same range and the primary trace must be of the longer wavelength.

To conduct a macro bend analysis, open the file manager as described in chapter 10. Highlight the first trace to be loaded (the trace of the longer wavelength) and select to open. Open the file manager again and highlight the trace to be compared (the trace of the short wavelength), open the drop-down menu under the file tab and touch dual or use the up or down buttons to highlight dual and press select. Open the event analysis screen to check for macro bends. If an event on the longer wavelength trace has 0.25db or greater loss than the same event on the shorter wavelength trace, a macro bend event will be generated on the event table, identified by a Macro label in the Type column. This event will immediately follow the event it is related to. For example: If event number one was 5 dB at 1550nm and .5 dB at 1310nm, the second event will be blank for location, +4.5dB for splice, blank for 2point and DB/KM. The type field will be listed as Macro.

To exit dual trace and macro bend analysis, start a new scan.

### Event Analysis Screen

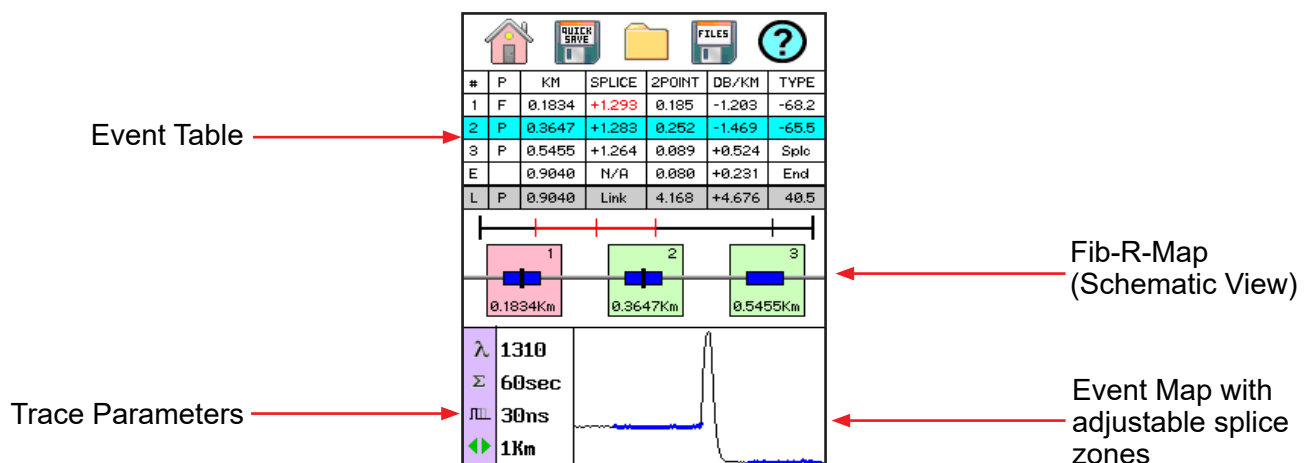


Fig 8.10

## Chapter 8 OTDR Operation

### Fib-R-Map

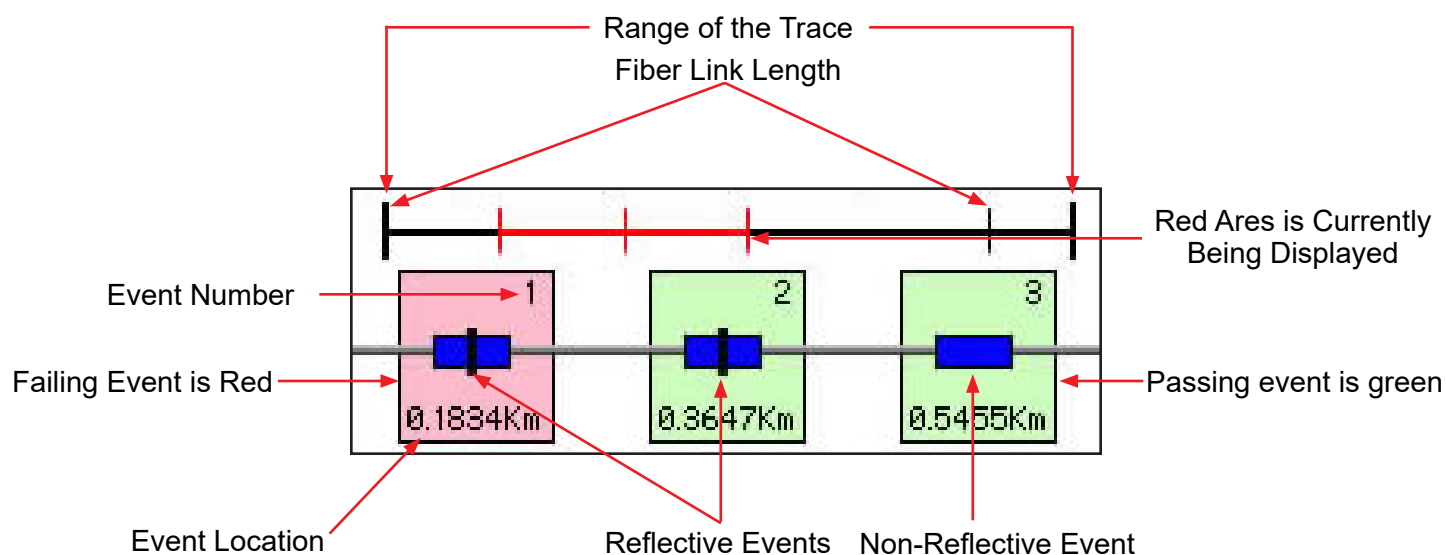


Fig 8.11

### Note

The End of Fiber is the last item in the schematic view. It is labeled E in the event number position and displays a vertical Bar instead of horizontal.

### Event Table

Event Location	Event Loss in dB	Loss Between Previous and Current Events	dB Per/Km, Kf or Mi Between Events				
Pass/Fail	#	P	KM	SPLICE	2POINT	DB/KM	TYPE
Event Number	1	F	0.1834	+1.293	0.185	-1.203	-68.2
EOF Event Information	2	P	0.3647	+1.283	0.252	-1.469	-65.5
Link Information	3	P	0.5455	+1.264	0.089	+0.524	Splc
	E		0.9040	N/A	0.080	+0.231	End
	L	P	0.9040	Link	4.168	+4.676	40.5
				Link Loss	Link dB Per/Km, Kf or Mi		System ORL

Fig 8.12

## Chapter 8 OTDR Operation

### Event Table Field Description

#### **# Event Number:**

Indicates the event in sequence, where the higher the number, the further distance from the OTDR the event occurs. "E" (End) is the event determined to be the End of Fiber (EOF). "L" (Link) is the information relative to the full fiber trace.

#### **P:**

Pass/Fail, if any one of the thresholds are not met for an event, the P/F column will display an "F". The parameter that failed will be displayed in red. If all the parameters are met, this column will display a "P".

#### **Km or KF or MI:**

Event Location per unit of measure, Km for Kilometer, KF for Kilo-feet and MI for mile. This is the distance/location that the event occurs along the fiber link.

#### **Splice:**

Event Loss, is the loss of the splice, mated pair or other effect of the fiber considered as an event. (A positive number is the amount of dB loss and a negative number indicates a gain normally due to mismatched index of refraction.) This is an adjustable threshold for the Pass/Fail feature. The "E" event will display N/A and the "L" Link displays Link as these are not an event that would have meaning as a loss value.

#### **2POINT:**

2 Point Loss is the loss measured from the end of the dead zone of the previous event to the beginning of current event. The value in the "L" line of the table for this column is the link loss. The loss from the beginning of the trace to the event determined to be the EOF. This is the value used to determine if the fiber link passes or fails its link threshold.

#### **dB/Km or Kf or Mi:**

dB per Kilometer if in KM and DB/KF if in Kilo-Feet and DB/MI if in mile unit of measure. This is the calculated loss per Km, Kf or Mi from the end of the dead zone of the previous event to the beginning of the current event. The value in the "L" line of the table for this column is the dB Per/KM, Kf or Mi for the total link.

#### **TYPE:**

Event Type lists Splice for non-reflective events and displays a reflectance value for reflective events. The "E" end event is marked End and the "L" event displays the System ORL.

## Chapter 9 Project Management

### 9.1 Project Management Description

Project Management allows the user to save a set of parameters to be recalled for use at a later time. It also incorporates the file management system to save traces to the active project folder. When the OTDR is turned on, the default project is [Default]. If an existing project is not open or a new one not set, all traces will be saved to the [Default] folder.

#### **Note**

It is necessary to create the project prior to taking a trace as the file will not be available to save after going through the project creation sequence.

#### **Project Management Screen**

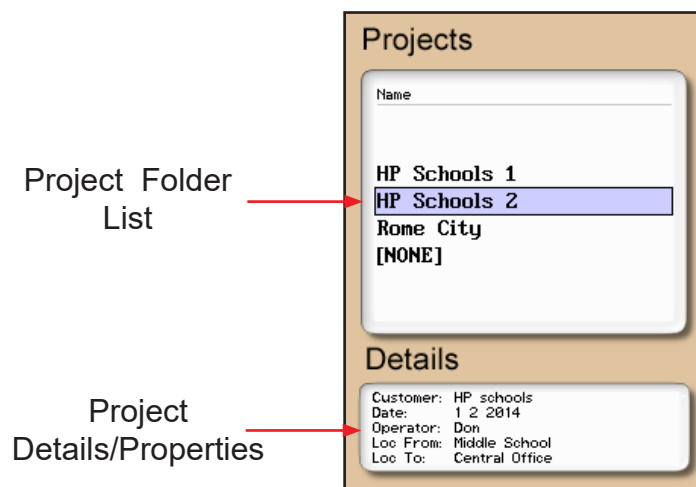


Fig 9.1

**Project Management Menu** The menu for project management may be operated with the touch screen, however, this manual describes the manner of operation with the keypad. To open the menu press the menu button. There are four tabs available, File, Edit, View and Help. Use the left or right buttons to move to a desired tab and use the select or the down button to open the drop-down menus. Pressing the menu button again or the up button will hide the operations menu.



Fig 9.2

#### **Touch Screen Tip**

The menu may be pulled down with the stylus the same as the menu on the main trace screen. Once the file menu is open, it is fully operable with the touch screen function.

# Chapter 9      Project Management

**Project Management File Tab** To open the drop down menu under file, with file tab highlighted, press Select or the down button. Use the down or up buttons to move through the drop down menu and press Select to choose an operation. Selecting new will open a new project folder using the current parameter settings. Open will open the highlighted project, dual is not operational in the project management and therefore greyed out, delete permanently removes the highlighted project. (The delete button must be held for at least one second to remove projects.) Once delete is selected, the project and all files associated with that project are deleted. Use exit to leave the project manager and return to the trace screen.

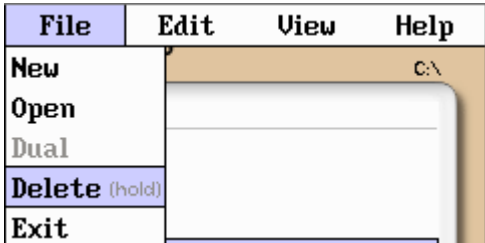


Fig 9.3

**NOTE:**

Once a project is established the settings cannot be permanently changed. They may be changed Temporarily, but the original setting will be defaulted every time the project is opened.

**Project Management Edit Tab**

To open the drop-down the menu under edit, with the edit tab highlighted, press select or the down button. Use the down or up buttons to move through the drop down menu and press select to choose an operation. Upload is used to transfer files to the CertSoft software. Rename allows the highlighted folder name to be modified while maintaining all settings and associated files. Properties allows the user to edit the details/properties displayed at the bottom of the project window.

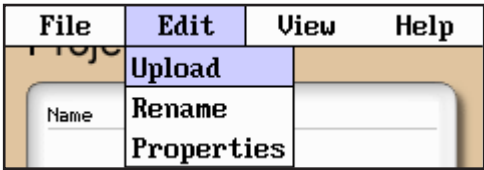


Fig 9.4

**Project Management View and Help Tabs**

View offers the user the opportunity to move to the file manager from the projects page. With view highlighted, press select or the down button to open the drop-down menu, with the files tab highlighted, press select to move to the file management page. For onboard help pages, highlight the help tab and press select.

 


Fig 9.5

## Chapter 9 Project Management

### 9.2 Project Management Operation

#### **Create a New Project**

The parameters that are stored for a project are; range, pulse width, average, wavelength, distance units, pulse width units, event sensitivity and the thresholds. To create a new project, press menu, select the settings icon, set the parameters as required, when all settings are established, use the arrow button to highlight the return button or touch return at any time while in the settings screen. Press the menu button, highlight the project folder icon and press select. With the file tab highlighted, press select or the down button to open the drop down menu. Use the down or up buttons to highlight new and press select again. Use the on-screen QWERTY keyboard to name the folder/project and touch save. The folder names are limited to 16 characters.

To enter details about the project, use the up and down buttons to highlight the project that was just created and press the menu button. Use the left or right button to highlight the edit tab, use the down button to highlight properties and press select. Use the up and down buttons to select the desired field to be entered or modified and press select. Use the QWERTY keyboard to enter the information and touch save when complete. Up to 24 characters may be entered for these fields. To exit the project screen, press menu, press select, use the down button to highlight exit and press select again.

#### **Open an Existing Project**

To open a project, press the menu button, highlight the project folder and press the Select button. Use the up or down buttons to highlight the desired project folder and press the Select button. This will open the file management screen listing all the files previously stored in this project. All traces saved will now be stored to this project, until another project is opened.

#### **Delete a Project**

To delete a project, with the project to be deleted highlighted, open the file drop down menu, highlight delete and press and hold the Select button. Ensure the proper project is selected as once deleted, the folder and files cannot be recalled.

#### **NOTE:**

Delete must be held for approximately 2 second to complete the delete function.

#### **Upload a Project to CertSoft**

To upload a folder and all its associated files from the OTDR to the computer, open the CertSoft software and ensure the OTDR is connected to the computer with the USB cable.

#### **NOTE:**

The two plugs in the top right corner of the computer software screen should show as connected and green.

Highlight the project to be uploaded, press menu to open file manager menu, use the right button to highlight edit tab, press select or the down button to open the drop down menu and with upload highlighted, press select. The folder with all files will be uploaded to the target folder selected on the computer.

## Chapter 9      Project Management

### **Rename a Project**

To rename a project, have the project to be renamed highlighted, press menu, to open the project management menu. Use the left and right buttons to highlight edit tab and press select or the down button to open the drop-down menu. Use the down button to highlight rename and press select. The project name will be displayed with the on-screen QWERTY keyboard. Use the keyboard to rename the project and touch save.

### **Modify Properties**

To modify the properties, have the project to modified highlighted. Press menu, highlight edit/properties and press select. The project properties will be displayed, use the up/down buttons to highlight the field to be changed, use the on-screen QWERTY keyboard to make the change and touch save. Continue with the changes needed, when complete highlight close and press select.

### **Temporary Modification of Parameters**

Test parameters may be temporarily changed by selecting new settings, such as wavelength, average time, pulse width, and range directly on the main OTDR screen with the touch screen capabilities or open the parameter settings screen, set the new parameter and save. All subsequent test will use the new settings until the original settings are returned or the folder is reopened resetting the project parameters. To make temporary changes to event sensitivity or thresholds, open the parameters settings page.

### **Exit Project Management**

To exit the project management, press menu, use the left or right buttons to highlight the file tab, press select or the down button to open the drop down menu. Use the down button to highlight Exit and press select.



# Chapter 10 File Management

## 10.1 File management Description

File Management is use to save and recall traces, loss test and VIP images. It operates in conjunction with the projects manager in that if a project folder is open, the files saved to and listed in the file manager are associated with the open project. When the OTDR is turned on, the default folder is [Default], therefore, any files save without opening a project will be save to the [Default] folder. Any files saved with the LTS or scope functions will also be associated with the open folder.

### File Management Screen

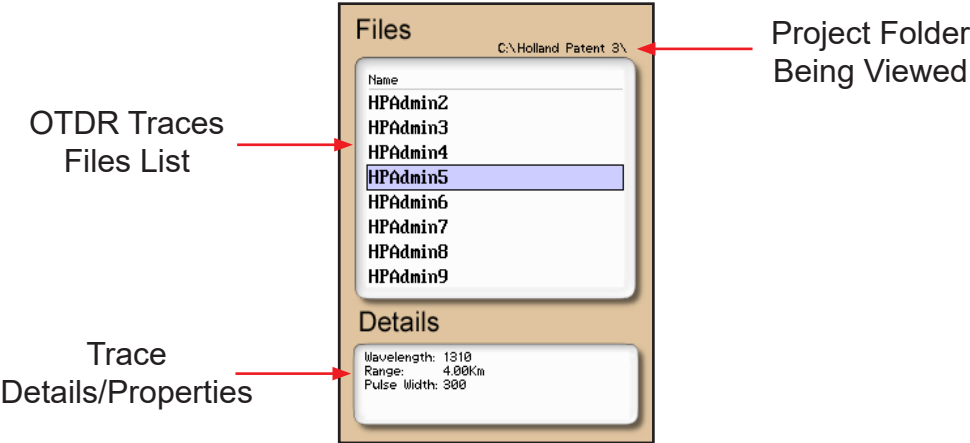


Fig 10.1

### File Management Menu

The menu for file management may be operated with the touch screen, however, this manual describes the manner of operation with the keypad. To open the file management menu press the menu button.

 


Fig 10.2

### Touch Screen Tip

The file menu may be pulled down with the stylus the same as the menu on the main trace screen. Once the file menu is open, it is fully operable with the touch screen function.

# Chapter 10 File Management

## File Management File Tab

To open the drop down menu under file, with file highlighted, press select or press the down button. Use the down or up arrow to move through the drop down menu and press select to open the highlighted operation. The operations are Save, Open, Dual, Delete and Exit. Save stores the current trace, Open displays the trace that is currently highlighted, Dual opens a secondary trace, Delete permanently removes a file and Exit closes the file management screen.

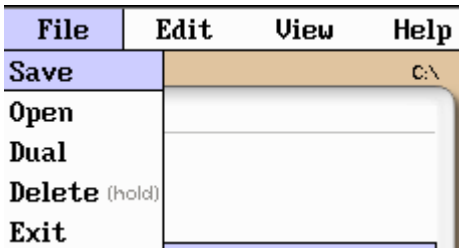


Fig 10.3

## File Management Edit Tab

To open the drop down menu under edit, with edit highlighted, press select or press the down button. Use the down or up arrow to move through the drop down menu and press select to choose a highlighted operation. Upload is used to transfer the highlighted file to the CertSoft software. Rename allows the highlighted file name to be modified. Properties is grayed out and not accessible from this location.

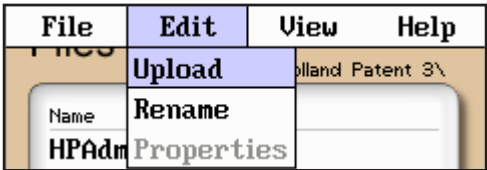


Fig 10.4

## File Management View and Help Tabs

View offers the user the opportunity to move to the projects management page from the file management page. With view highlighted, press select or the down arrow to drop down the view tab and press select to move to the file management page. For onboard help pages, highlight the help tab and press select.

 


Fig 10.5

## 10.2 File management Operation

### Save a Trace

To save a trace, press menu, highlight the file manager icon and press Select. Press the Select button or the down button to open the drop down menu and with save highlighted, press Select again. The file naming window will open and the onboard QWERTY key board will be available. Use the touch keyboard to name the file and touch save. The file names are limited to 16 characters. This method should be used to set the base file name for a group of traces. These file names are save exactly as entered. To save files with a chronologically numbered suffix, use the quick save. Quick Save uses the last enter base file name. If a Base file name of SAMPLE is saved, the first Quick Save file will be SAMPLE.1, next SAMPLE.2 etc.

## Chapter 10 File Management

### **Open/View a Trace**

To open a trace, press the menu button, highlight the file folder and press select. Use the up or down buttons to highlight the trace to be viewed and press select.

### **Dual Trace Mode**

Dual trace mode may be used to view and compare two traces. Both traces must be of the same range setting. To utilize dual trace feature, first open the primary trace as you would a normally, by highlighting the trace in file management, pressing menu to open the file management menu, with file highlighted, open the drop-down menu use the down button to highlight dual and press select. The trace opened using the dual feature is the secondary trace and all information displayed is that of the primary trace. To exit the dual trace mode, start a scan with the scan button.

### **Delete a File**

To delete a file, with the file to be deleted highlighted, press menu or the down button to open the file drop down menu, use the down or up buttons highlight delete and press select for at approximately 2 seconds. Ensure the proper file is selected as once deleted, the file cannot be recalled.

#### **NOTE:**

Delete must be held for approximately 2 seconds to complete the delete function.

### **Upload a Trace to CertSoft**

To upload a trace from the OTDR to the computer, Open the CertSoft software and ensure the OTDR is connected to the computer with the USB cable.

#### **NOTE:**

The two plugs in the top right corner of the computer software screen should show as connected and green.

Highlight the file to be uploaded, press menu to open file manager menu, use the right button to highlight the edit tab, press select or the down button to open the drop down menu and with upload highlighted, press select. The file will be uploaded to the target folder on the computer .

### **Rename a Trace File**

To rename a trace file, have the file to be renamed highlighted. Press menu, use the left or right button to highlight edit, press select, or the down button to open the drop-down menu, press the down button to highlight rename and press select. The file name will be displayed with the on-screen QWERTY keyboard. Use the keyboard to rename the project and touch save.

### **Exit File Management**

To exit the file management, press menu, use the left or right buttons to highlight the file tab, press select or the down button to open the drop down menu. Use the down button to highlight Exit and press select.

# Chapter 11 Video Scope

## 11.1 Entering Video Scope Function

To operate the video scope, from the home screen, highlight the Scope icon and press the select button. If a probe is not connected already, connect the VIS300 video probe to the video probe port on the top of the OTDR.

## 11.2 Video Scope Display

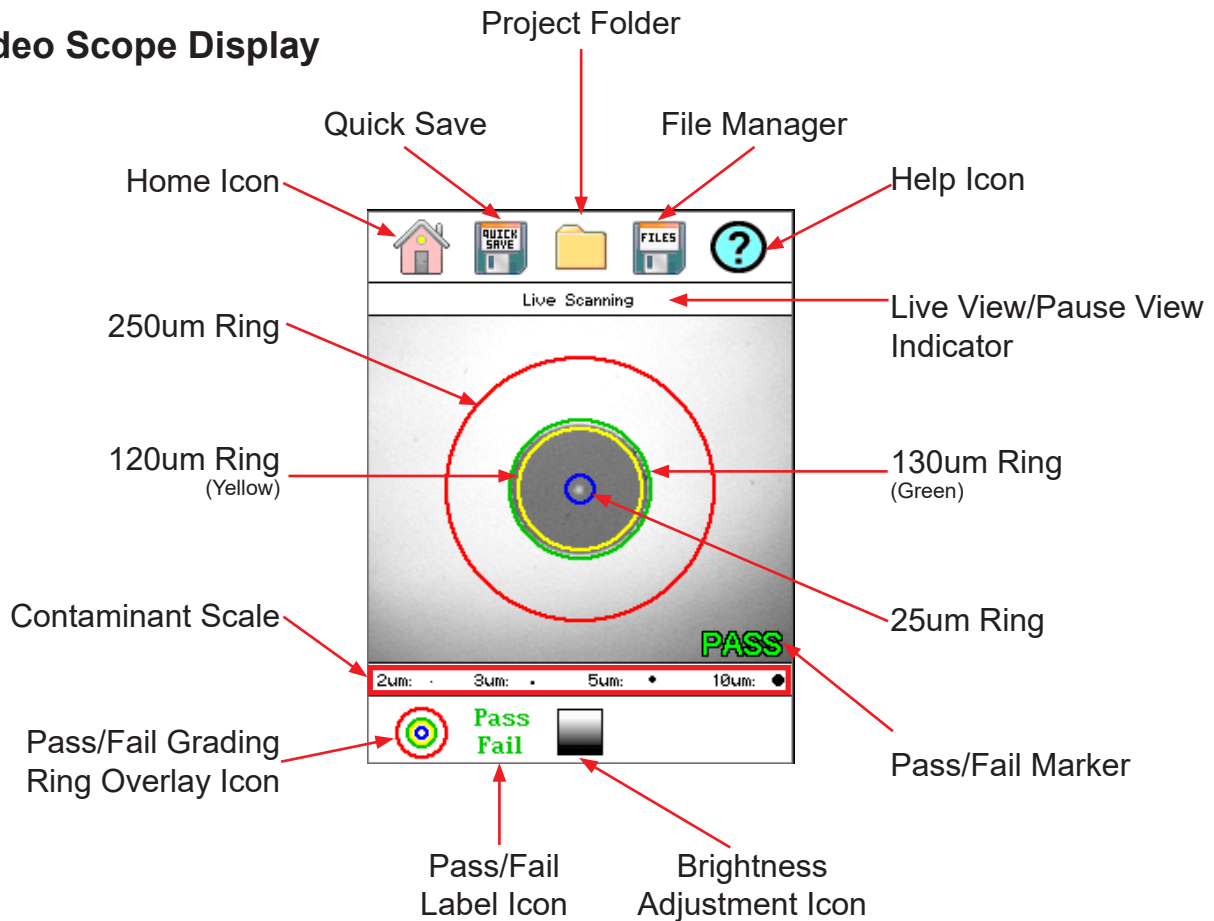


Fig 11.1

### Touch Screen Tip

The icons on the video scope screen are operational with the touch screen feature, though this guide is written using the keyboard whenever it is available.

## 11.3 Video Scope File/help Icon Menu

The Icons at the top of the display are Home, file save, project management, file management and Help.

### Home

Press the menu button, use the left and right buttons to highlight the home icon and press select to return to the home Screen.

# Chapter 11 Video Scope

## **Quick Save**

Press the menu button, use the left or right buttons to highlight the quick save icon and press the select button to store a file image of the scope screen in the file folder within an active project. Scope files will be preceded by a target icon.

## **Project Management**

To open project management, press the menu button, use the left or right buttons to highlight the project management folder icon and press select. Use the project management folder to open the project that the scope images are to be stored. When entering the video scope function, the active folder will be the one last used in the OTDR or LTS. For more information about the project management system, please refer to Chapter 9 of this guide.

## **File Management**

To open file management, press the menu button, use the left or right buttons to highlight the file management icon and press select. Use File management to view a list of saved files or to open a stored image. File types are identified by the preceding icon. Trace files are indicated by a trace icon, LTS file by an LTS icon and scope files are preceded by scope (target) icon

## **Help**

Press the menu button, use the left and right buttons to highlight the help icon and press select to view the help information.

## 11.4 Video Scope Operation Icon Menu

The following functions are only available for use when the the video scope is in live scan mode.

### **Grading Rings**

Used to turn on and off the rings that indicate the IEC61300-3-35 grading zones.

by entering the menu mode with the menu button, use the LRUD buttons to highlight the pass/fail grading rings overlay icon and press the select button. Exit the menu mode and use the LRUD buttons to center the image in the rings. Use the Pass/Fail Criteria Tables from page 44 to grade the connector end face. 2, 3, 5 and 10 micron contaminant examples are displayed just below the connector image on the video scope display.

### **Pass/Fail Label**

Used to turn cycle through P/F (Pass/Fal) Off, P/F Man (In Red "Fail"), P/F Man (In Green "Pass") and P/F auto. To set the pass/fail indicator, press the menu button, use the left or right buttons to highlight the pass/fail icon and press select to cycle through the pass/fail states.

The touch screen may also be used to make these selections.

# Chapter 11 Video Scope

## **Brightness**

Press the menu button, use the left and right buttons to highlight the brightness icon, use the up and down buttons to adjust the brightness level of the display or cycle through the brightness levels by pressing the select button.

## **11.5 Video Scope Operation**

To operate the video scope, from the home screen, highlight the Scope icon and press the select button. If a probe is not connected already, connect the VIS300 Video Probe to the video probe port on the top of the OTDR.

### **Video Probe Tips**

There are a number of video probe tips available. To remove a tip from the Probe, grasp the probe tip and unscrew the tip retention nut from the tip. Pull the tip straight up from the probe. To place a tip on the probe, ensure the lens is clean, slide the tip on to the end of the probe and tighten the tip retention nut. Do not overtighten the retention nut.

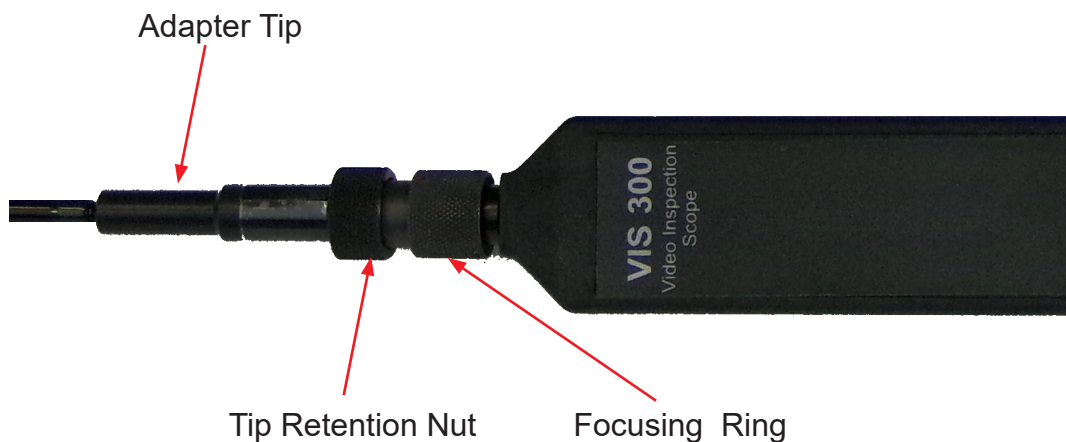


Fig 11.1

### **Viewing/Focusing a Connector**

With the video scope turned on and the video probe plugged into the OTDR, insert a connector in to universal tip or insert the panel adapter tip into the appropriate port. The scope must be in the live scanning mode to make focus adjustments. Use the focus ring to get the connector image as sharp as possible. When using panel adapters it is possible to turn the body of the probe to while the adapter is inserted into the panel to make focus adjustments.

### **NOTE:**

To make position adjustments with the LRUD buttons, the unit must not be in menu mode. Menu mode is evident when there is a light blue box positioned around one of the icons. When the touch screen is used to roughly center the connector image, the menu mode is automatically turned off.

# Chapter 11 Video Scope

## **Centering a Connector Image**

Once the image is stable and focused, use the stylus to touch the approximate center of the connector to snap the image near the center of the display and the center of the grading rings. Use the LRUD buttons to fine tune the image to the center of the display.

## **Pausing Image Scan**

To freeze an image in position and focus level for inspection, press the scan button. This will pause the image at the current position and focus level. Simply press the scan button again to set the operational mode back to live mode for focus and position adjustments

## **Grading Rings**

Turn on or off the grading rings by pressing menu and using the left or right buttons to highlight the grading ring icon and press select. The unit must be in live scan mode to turn the rings off or on.

## **Pass/Fail**

Use the pass/fail criteria tables on the next page to determine if the connector passes the IEC61300-3-35 standard. There is a guide to contamination size located at the bottom of the image. To mark a connector as Pass or Fail, enter the menu mode, highlight the Pass/Fail Label icon and press select to cycle through pass, fail, or no grading. This must be done in the Live Scan mode. Once the pass fail status has been entered, the scan may be paused with the scan button and the points of contamination that caused a failure may be marked on the image.

## **Auto Pass/Fail**

Once the image has been centered in the grading rings, set the P/F icon to Auto and press the scan button. The video scope will evaluate the image and grade it with Pass or Fail. Contamination will be displayed on the image.

## **Marking Points of Contamination**

To mark the points of contamination the unit must be in paused mode. Pick up the contamination marker by using the stylus and touching the contamination sample size that is required. Touch the image to place the marker. The marker may be fine tuned with the stylus to cover the contamination point on the image to be marked. Once the marker is positioned properly, touch the area just below the image that states, "Place marker, touch here to apply" to lock the marker in place. Repeat this as necessary to mark all the points that need to be indicated for the pass/fail status. At this point the image should be saved with the Quick Save icon

### **NOTE:**

Marking the points of contamination should be done last, just before saving the image. Once the unit is returned to live mode the markers are removed.

## **Exiting Video Scope Operation**

Enter the menu mode, use the left or right buttons to highlight the Home icon and press select.

## **Touch Screen Tip**

The majority of function and features in the Video Scope are operable with the touch screen. It is not necessary to enter the menu mode when using the touch screen. The menu mode needs to be entered when the focus of the LRUD buttons needs to be taken off the positioning feature and moved to the icon cursor.

# Chapter 11 Video Scope

## Pass/Fail Criteria Tables

### Fiber End Face Criteria Table for Angled PC Polished Connetors

Zone	Description	Diameter	Allowable Scratches (Width)	Allowable Defects (Diameter)
A	Critical Zone	0µm to 25µm	≤ 4µm	None
B	Cladding Zone	25µm to 120µm	No limit	No Limit < 2µm 5 from 2µm to 5µm None > 5µm
C	Adhesive Zone	120µm to 130µm	No limit	No limit
D	Contact Zone	130µm to 250µm	No limit	None ≥ 10 µm

### Fiber End Face Criteria Table for Ultra PC Polished Connetors

Zone	Description	Diameter	Allowable Scratches (Width)	Allowable Defects (Diameter)
A	Critical Zone	0µm to 25µm	None	None
B	Cladding Zone	25µm to 120µm	No limit ≤ 3µm None > 3µm	No Limit < 2µm 5 from 2µm to 5µm None > 5µm
C	Adhesive Zone	120µm to 130µm	No limit	No limit
D	Contact Zone	130µm to 250µm	No limit	None ≥ 10 µm

### Fiber End Face Criteria Table for SM PC Polished Conn. (Single Mode Fiber, RL ≥ 26 dB)

Zone	Description	Diameter	Allowable Scratches (Width)	Allowable Defects (Diameter)
A	Critical Zone	0µm to 25µm	2 ≤ 3µm None > 3µm	2 ≤ 3µm None > 3µm
B	Cladding Zone	25µm to 120µm	No limit ≤ 3µm None > 3µm	No Limit < 2µm 5 from 2µm to 5µm None > 5µm
C	Adhesive Zone	120µm to 130µm	No limit	No limit
D	Contact Zone	130µm to 250µm	No limit	None ≥ 10 µm



# Chapter 12 Loss Test Set

## 12.1 Entering Loss Test Set Function

The OVR may be equipped with a Loss Test Set which includes the power meter and CW source. On the home screen, touch the LTS icon or use the left or right button to highlight the LTS Icon and press SELECT. All OTDRs will support the stable Light Source, though not all OTDRs will support the Power Meter.

### **NOTE:**

All OTDRs will support the stable Light Source, though not all OTDRs will include the Power Meter.

### **NOTE:**

The touchscreen operation will be used to guide the user through Loss Test Set operation.

## 12.2 LTS File/Help Icon Menu

### **Home**

Touch the home icon to exit the LTS function and return to the home Screen.

### **Quick Save**

Quick Save: Touching this icon will save the value on the display to the active project folder with an LTS label and files will be automatically incremented to the next numbered suffix.

### **Project Management**

Project Folder: Opens the project management screen. For a full description of project management operation, please refer to "Chapter 9" of this user's guide.

### **File Management**

File Manager: To open file manager touch the file manager icon. For a full description of project management operation, please refer to "Chapter 10" of this user's guide.

### **Help**

Press the menu button, use the left and right buttons to highlight the help icon and press select to view the context sensitive help information.

## 12.3 Light Source Operation

### **Selecting Light Source Wavelength**

The light source is located in the top left portion of the display. Touch the source indicated or the OFF indicator and a list of available sources will be displayed. Touch the desired wavelength to turn on that light source, or Disable to shut the light source off.

### **Selecting Light Source Modulation**

Modulation is located in the top right portion of the display. Touch the modulation value indicated and the list of available modulation values will be displayed. Touch the desired value to modulate the source or touch CW for a continuous wave. The available modulation values are CW, 270Hz, 1000Hz and 2000Hz.

# Chapter 12 Loss Test Set

## 12.4 Power Meter Operation

### Set Power Meter Wavelength

The Power Meter wavelength being tested is indicated in the bottom left of the display. To change the wavelength, touch the indicated value below Power Meter and a list of calibrated wavelengths will be displayed. Touch the wavelength to be tested and begin the test. Available wavelengths are 850/1300/1310/1490/1550/1625nm for standard OTDRs and PON OTDRs. The CWDM OTDR has the standard wavelengths calibrated plus 1431-1611nm.

### NOTE:

In the bottom right portion of the screen is reference indicator, this is where a reference may be set as well as setting the units of measure.

### Set Reference

Connect the reference cable/s to the appropriate ports and touch reference in the bottom right of the display, touch the Set Reference tab and a non-volatile reference value will be displayed below the reference indicator in the bottom right of the display.

### Set Measurements Units

The power meter displays measurements in dB (Relative) or dBm (Absolute) units of measure. dB measurements are used with a set reference as described above. dBm measurements do not take into account the reference and display the absolute power value received by the detector.

## 12.4 LTS Project Management

To save loss measurements to a project, touch the project management icon, highlight the project to be used and touch it again to open the projects folder. A list of files associated to that folder will be displayed. OTDR files are preceded with trace icon, the LTS file will have an LTS icon and scope files will be preceded by a target icon. To return to the LTS screen exit the file management screen by drawing down the file management menu, touching file to open the drop-down menu and touch the exit tab. For a full description of project management operation, please refer to "Chapter 9" of this user's guide.

## 12.5 LTS File Management

To open file manager touch the file manager icon. To save a file using the file manager, with the test data on the display, open the file management, open the drop-down menu under file by touching the file tab and touch save. Name the file as desired with the on-screen keyboard. Touch the file tab with Save highlighted press SELECT. Use the on-screen keyboard to enter a file name. For a full description of project management operation, please refer to "Chapter 10" of this user's guide.

### NOTE:

File names will be saved exactly as entered using this method. To have the files saved with incrementally number suffixes, use the file manager to save the base file name with the suffix number as the first file to be save in a sequence and then use the Quick Save icon moving forward. Example: Use file manger to save the file test as test.001 and when you use quick save for the next test, the file name will be test.001.

## 12.6 Exiting Lost Test Set

Touch the Home icon to exit the loss test set function and return to the home screen

## Chapter 13 Specifications

### 13.1 OTDR Specifications

	OVR	OVR-PON	OVR-CWDM
Wavelength	850, 1300 MM 1310, 1490, 1550, and 1625nm SM ( $\pm 20$ nm)	1310, 1550, and 1625nm ( $\pm 20$ nm)	1471, 1491, 1511, 1531nm or 1551, 1571, 1591.1611nm $\pm 3$ nm
Dynamic Range	26/27dB MM 39/38/39/39dB SM	38/39/39 dB	36dB
Pulse Width	5 - 20,000 ns		
Units of Measurement	Kilometer, Kilo feet and Mile		
Event Dead zone	1m		
Attenuation Dead Zone	4m		
Resolution	.125 - 32m		
Distance Uncertainty	$\pm(0.75\text{m} + 0.005\% \times \text{distance} + \text{sampling resolution})$		
Full Scale Distance Range	0.25-64km MM , 0.25-240km SM		
Typical Real-time Refresh Rate	2 Hz		
Group Index of Refraction (GIR)	1.024 - 2.048		
Linearity	$\pm .05$ dB/dB		
Memory Capacity	~1000		
Memory Type	Internal		
Power Supply / Charger	Universal 100-240V		
Battery Type / Life	Li-ion / 9hr typ.		
Storage Temperature	-20 to 60 C		
Operating Temperature Range	-10 to 50 C		
Dimensions (without rubber boot)	8.07" L x 3.89" W x 1.57" H (205mm L x 99mm W x 40mm H)		
Weight	1.6 lbs.		
Communications ports	USB		
Connector Styles	FC, ST or SC Interchangeable		

### 13.2 Power Meter Specifications

Detector Type	InGaAs
Connector Type	2.5mm Interchangeable
Dynamic Range	+5 to -77dB (CATV - +25 to -57dB)
Calibrated Wavelengths	850,1300,1310,1490,1550,1625nm (standard units) + 1431-1611nm (CWDM units)
Power Measurement Uncertainty	$\pm 0.18$ dB under reference conditions, $\pm 0.25$ dB from 0 to -65 dBm, $\pm 0.35$ dB from 0 to +5 dBm and from -65 to -77 dBm
Units of Measurement	dBm, dB
Resolution	.01 dB

### 13.3 Light Source Specifications

Fiber Type	Single mode, Multimode
Wavelengths	Determined by OTDR Configuration
Output Power	0 dBm
Laser Safety Classification	Class I Safety Per FDA/CDRH and IEC-825-1 Regulation
Modulation Modes	CW, 270 Hz, 1000 Hz, 2000 Hz

\* Light source wavelengths present are determined by the OTDR configuration

FIS reserves the right to change specifications without notice.

## **Chapter 14     Repair/Warranty**

### **14.1   Repair Information**

If repair is required, simply call the factory at 800-500-0347 for return instructions and a RMA number.

### **14.2   Warranty Information**

This product, including all mechanical, electrical, and optical parts and assemblies are unconditionally warranted to be free of defects in workmanship and material for a period of one (1) year from the date of delivery.

This warranty does not apply to expendable parts such as batteries or optical panel connectors, nor to any instrument or component which has been subjected to misuse, alteration, or fiber connector damage. It is the customer's responsibility to understand all the instructions and specifications prior to operating this instrument. This warranty does not extend to any loss or damage consequent to the failure of the warranted product.

## Chapter 15    Version Control

### 15.0    Version Control

Through a Program of continuous improvement the upgrade of the features and performance of this instrument are an on going process. The instrument firmware version is accessible in the lower right corner of the home screen. The version changes and approximate release dates are as follows.

OTDR V1.0.0.0 - 02/2014 - Original release

V1.1.0.4 - 05/2014 - Event table and schematic access from OTDR screen via tabs

Event marker overlay on trace graph when in either event or schematic tab

Redesigned the scope screen including new large icon menus and the defect size gauge overlays

Support for virtual instrument control via both CertSoft and android app

Independent IOR settings per wavelength

Increased total maximum number of files as well as maximum number of files in each project

V1.1.0.5 - 05/2014 - Field upgradable help text via windows reporting software

V1.2.0.0 - 08/29/14 - Added system ORL threshold setting with P/F analysis in event table

V1.3.0.1 - 04/03/15 - "A1" - support for Li-ion batteries, increased max file per project to 4000

V1.4.0.0 - 09/15/15 - Added support for CWDM wavelengths